


REPAIRS KEY

-  Repoint Area of Masonry with Lime Mortar
-  Lime Mortar Repair
-  Replace Failed Plaster, with new lime plaster
-  Repoint a Specific Joint with Lime Mortar
-  Work to a Miscellaneous Item; refer to notes for details
-  Redecorate Joinery
-  Repaint Masonry
-  Refurbish Rainwater Goods
-  Remove cement mortar and repoint with lime putty mortar
-  Remove cement render and replace with new lime putty render
-  Miscellaneous Item Removed
-  Replacement section of joinery

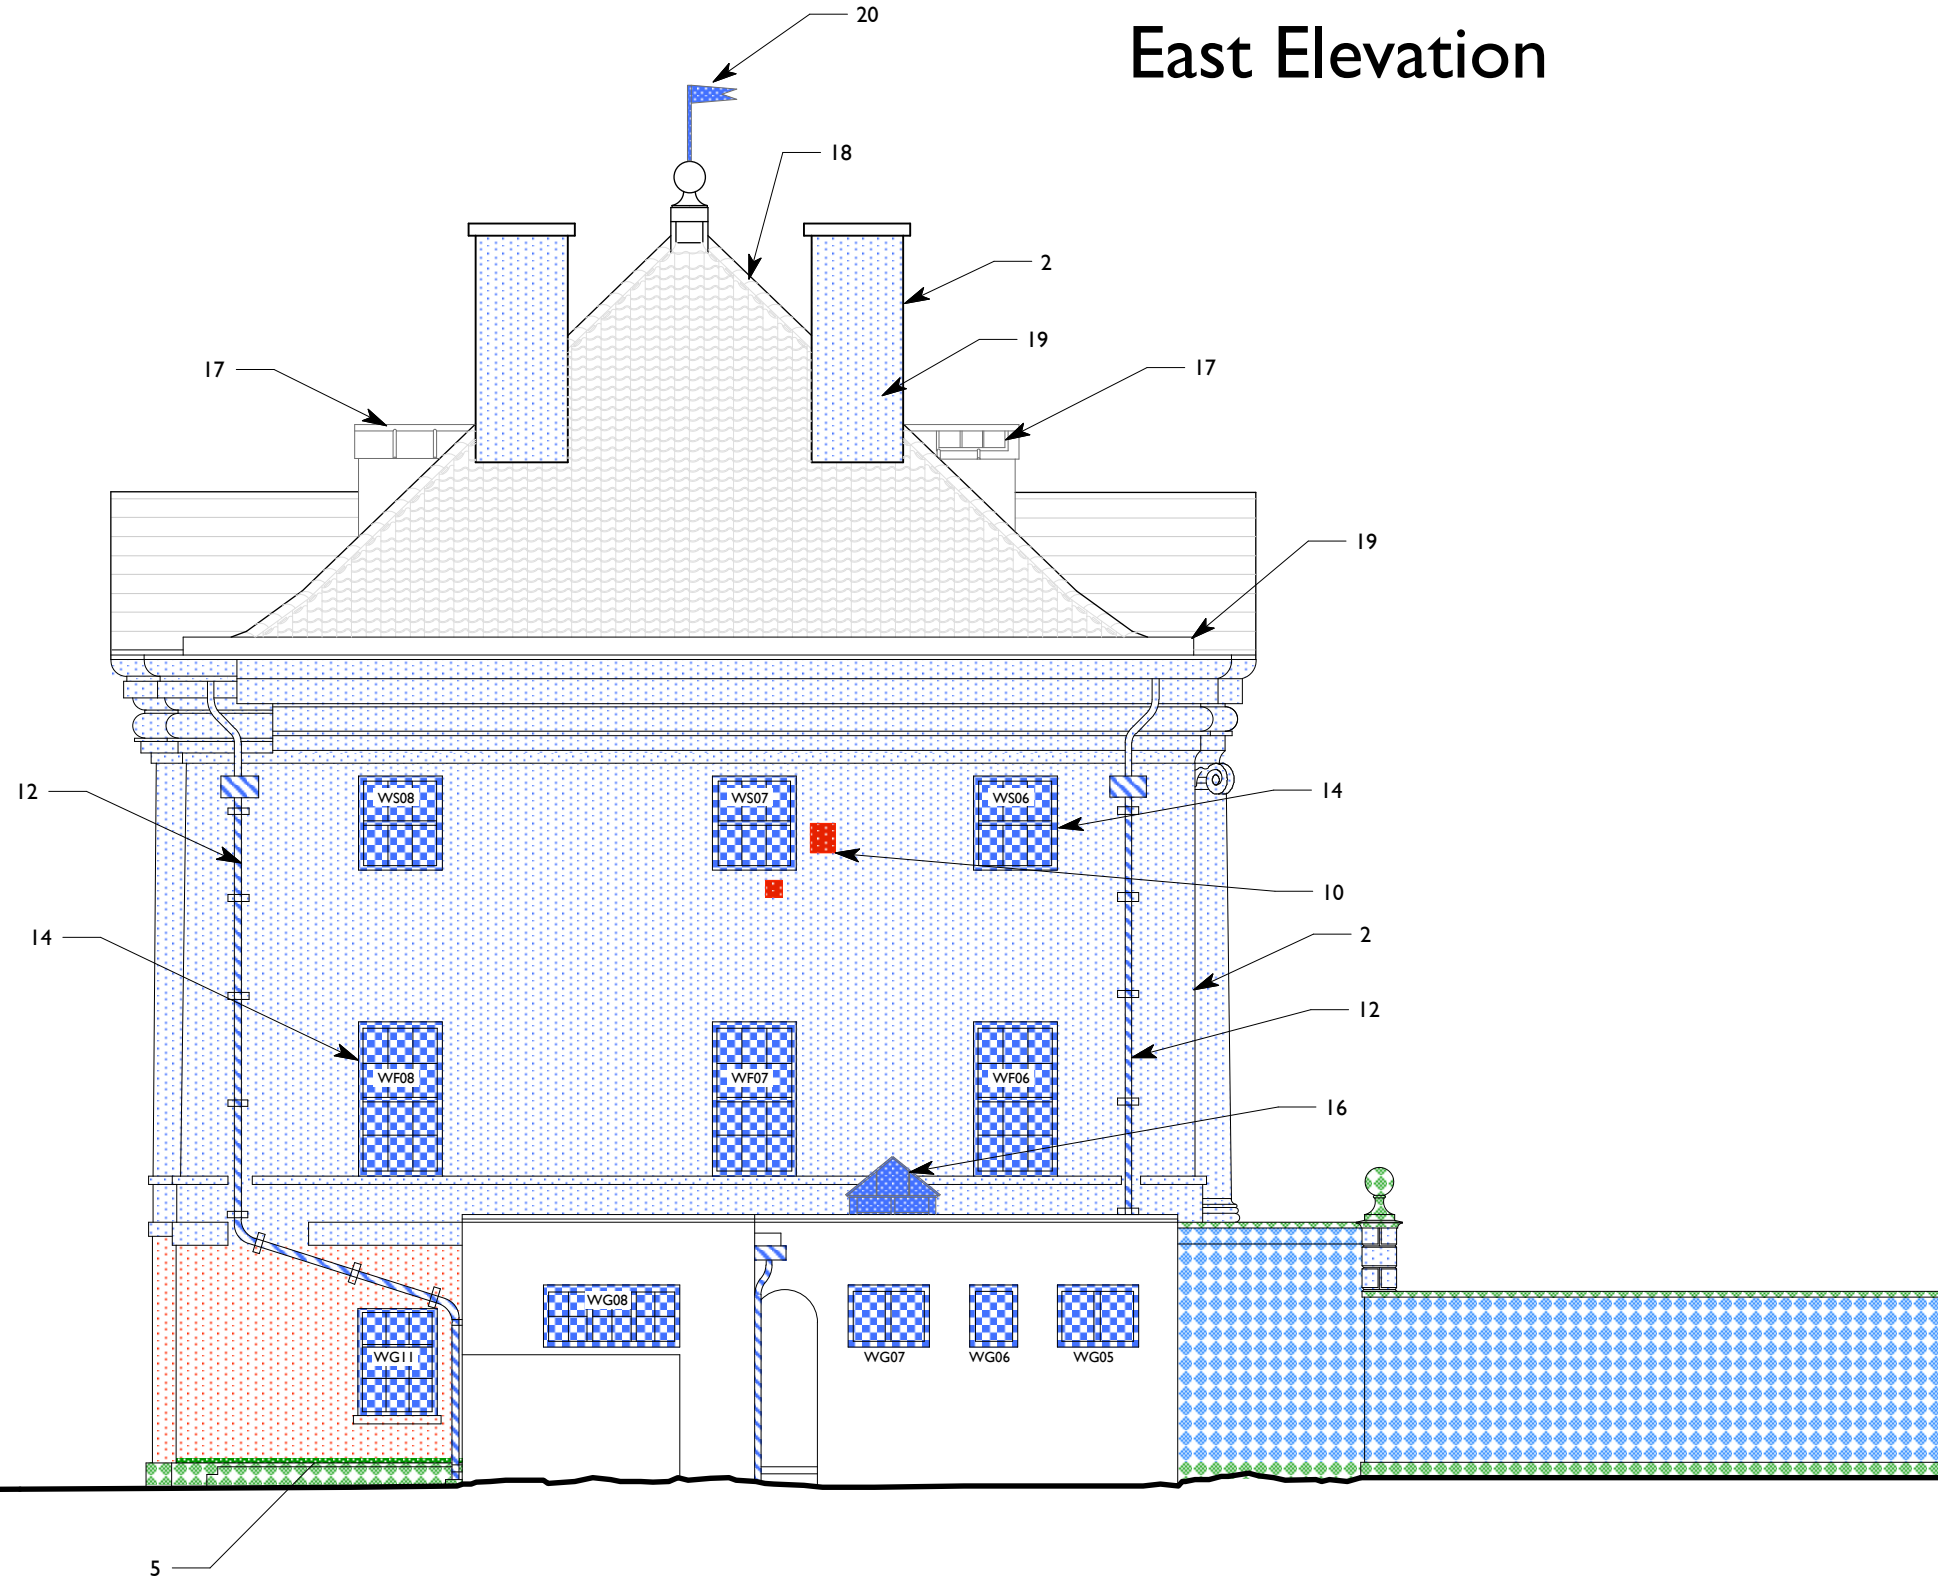

East Elevation



DO NOT SCALE THIS DRAWING USE DIMENSIONS ONLY
 VERIFY ALL DIMENSIONS ON SITE BEFORE COMMENCING ANY WORK OR SHOP DRAWINGS
 INFORM THE ARCHITECT BEFORE ANY WORK STARTS IF THIS DRAWING EXCEEDS THE QUANTITIES IN ANY WAY

Revision Date

DRAWING ISSUE STATUS	REVISION N°	DATE	SIGNED

Elevation Notes (these are shared between all elevations, some items won't apply)

1. Repoint stone plinth course, note specific percentages on drawing
2. Existing cementitious render (assumed), remove existing 'alkyd resin' masonry paint, make good any cracks with lime putty mortar and repaint with new silicate paint (Kiem).
3. Architectural features formed in render (possibly cementitious), remove existing 'alkyd resin' masonry paint, make good any cracks with lime putty mortar and repaint with new silicate paint (Kiem).
4. Remove cementitious render as indicated, make good and repoint brickwork with lime putty mortar and replaster with a lime putty plaster. Once cured, paint with limewash (to be confirmed).
5. Flaunch top of plinth with lime mortar
6. Remove airbrick and make good using brick and lime mortar infill.
7. Remove plastic siphons and make good with lime mortar (17no to West Elevation, 21no to North Elevation).
8. Repoint crack with lime mortar, refer to drawing for crack details.
9. Chemical DPC plugs; prepare to remove exceptionally hard cement filling to the chemical DPC holes.
10. Remove wall mounted plastic/metal boxes
11. Carryout lime mortar repair to corroded column capital; this will use ceramic armatures drilled into the existing substrate. Mortar selection will need to take place onsite to ensure that it is compatible.
12. Rainwater pipes; these are to be taken down and fully refurbished and reinstalled. They are to be put back in their original locations, they will be repainted with micaceous iron oxide undercoat and a Dulux Metalshield topcoat (colour to be determined, assume white as existing or lead grey), all joints are to be left uncaulked. The gully is to be replaced with a new accessible gully, the downpipes are to be fitted with a shoes.
13. Replace the lower portion of door; this will include the bottom rail and a lower 400mm of the stiles.
14. To the windows in addition to redecoration, generally allow as follows. 1 no completely new sash window (assume 1 no. of the larger windows. Allow to replace 8no sash bottom rails, 15no timber sills and the lower 500mm of 12no pairs of front cover boards. Prepare, treat and repaint the steel lintel to WG19
15. Prepare, treat and repaint the steel lintel to WG19
16. Rooflight, this is rotten and non-historic, allow to replace with an aluminium rooflight Works to Dormer Windows; in addition to redecoration, assume the following: Allow to fully replace 1 no. casement with a new casement to match. Also allow to replace the bottom rail and the external architraves to the remaining 3no. windows.
17. Repairs to roof tiles; assumed that a total of 100no tiles will need to be replaced with salvaged glazed pantiles.
19. Leadwork to roof; assume that localised patch repairs are required. assume that crack will need to be welded repaired in 30no locations. Also assume that the flashing to 1 no chimney will need to be replaced with new Code 7 sandcast lead.
20. Regild weather vane
21. Rear of wing walls, these are pointed in a cement mortar, remove cement pointing and repoint wall with lime putty mortar.

CLIENT
English Heritage

PROJECT
Marble Hill House

TITLE
Main House:
East Elevation; repairs

SCALE
1:100 @ A3

DATE
December 2016

JOB N°
16_132

DRAWN
HS

DRAWING N°
222

Acanthus House
57 Hightown Road
Banbury • Oxfordshire
OX16 9BE
Tel: 01295 702600
Fax: 01295 702601
architects@acanthuscleds.co.uk
www.acanthuscleds.co.uk



Acanthus
Clews
architects