




METHODOLOGY

1. Repair to brickwork and stonework to be minimal and limited to structural defects. Repair where necessary to reduce future weathering and water ingress.
Repointing to stonework and brickwork to be undertaken using a lime based mortar to match the tone and texture of existing mortar. Sample to be prepared on site for approval. Profile to match existing.
Stonework repair to fall under the categories;
 - Lime mortar/plastic repair
 - Stone indent
 - Stone replacement
2. The method of cleaning to all brickwork is to be light touch, non abrasive & the treatment to be of minimal impact to the underlying materials.
3. Tap testing of existing stonework & quoins is required to ensure it is structurally sound when scaffold is in place.
4. General scope of works to include the cleaning, unblocking of rainwater hoppers and inspection of downpipes and if required, replacement of downpipes with like-for-like cast iron downpipes.
5. General scope of works to include the complete removal of surface mounted wires and cables.
6. General scope of works to include the removal of netting & the installation of metal grating in lightwells for pigeon protection & protection from falling. Metal grating to be black & slimline. Structural support to sit under metal grating product.
7. General scope of works to include the removal of minimal existing pigeon deterrent spikes & their replacement in areas illustrated as outlined in PD1.
8. Further works may be identified as necessary once scaffold has been installed and further visual surveys can be undertaken.
9. General scope of works to include the complete removal of vegetation throughout.
10. Paint & lead spec to be conditioned.
11. General scope of works to include the decoration and painting of vents and grilles, to match specification of paint for rainwater pipes.
12. Brickwork to be repaired where scaffolding ties into brick.
13. Brickwork to be cleaned and repointed behind pipes and wires when removed.

1 WEST ELEVATION PROPOSED EXTERNAL REPAIRS
1 : 100

External Repairs Schedule - West (Application Rev 01)			
Reference	Purpose	Notes	Decoration
H&S1	Health & safety	Proposed location for lightning protection. Refer to suppliers drawing for further information.	—
MR91	Water ingress	Defective York stone window cill to be replaced with Portland stone cill	
MR92	Water ingress	Defective York stone window cill to be replaced with Portland stone cill	
MR93	Water ingress	Defective York stone window cill to be replaced with Portland stone cill	
MR94	Water ingress	Defective York stone window cill to be replaced with Portland stone cill	
MR95	Water ingress	Defective York stone window cill to be replaced with Portland stone cill	
MR96	Water ingress	Defective York stone window cill to be replaced with Portland stone cill	
MR97	Water ingress	Defective York stone window cill to be replaced with Portland stone cill	
MR98	Water ingress	Defective York stone window cill to be replaced with Portland stone cill	
MR99	Water ingress	Defective York stone window cill to be replaced with Portland stone cill	
MR100	Water ingress	Defective York stone window cill to be replaced with Portland stone cill	
MR101	Water ingress	Defective York stone window cill to be replaced with Portland stone cill	
MR102	Water ingress	Defective York stone window cill to be replaced with Portland stone cill	
MR103	Water ingress	Defective York stone window cill to be replaced with Portland stone cill	
MR104	Water ingress	Stone band to be re-pointed and isolated render repairs to be carried out where render is defective and loose. Stone on corner of West elevation to be replaced as methodology item 1	

- DECORATION KEY**
 E - Whole elevation
 DEC - Decoration
 CL - Cleaning
 FP - Protection from falling
 MR - Masonry Repair
- P - Pointing**
 RWP - Rain water pipes
 SVP - Soil vent pipes
 RE - Remove item
 R - Roof repairs
 PD - Pigeon deterrent wires

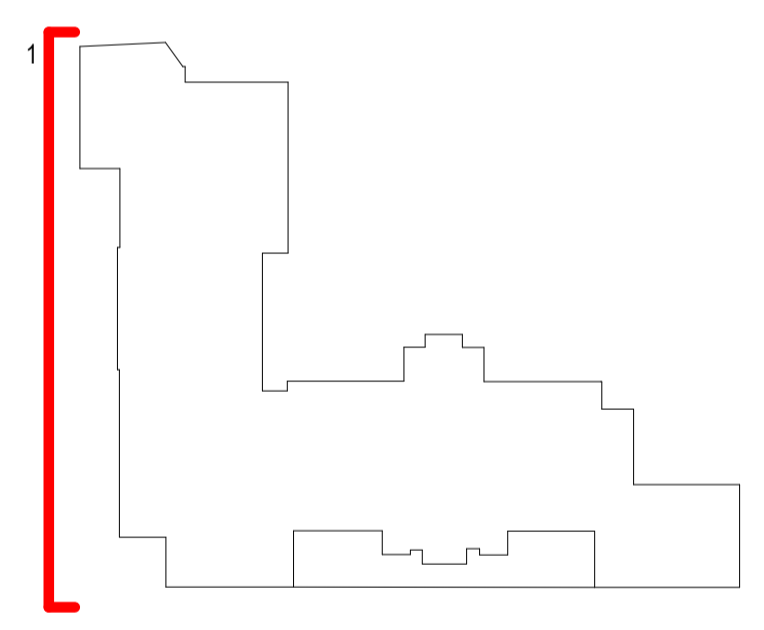

KEY PLAN:

LISTED BUILDING APPLICATION


0 5 m

REVISION	DATE	DESCRIPTION	ARCHITECT	PARTNER
S2 P 1	27.02.23	Listed Building Application	NM	ADP
D2 P 2	30.06.23	STAGE 4 ISSUE	AL	ADP
S2 P 3	21.07.23	References to separate planning application removed	LW	ADP
D2 P 4	07.08.24	Issued to Coniston	LW	ADP
D2 P 5	18.08.24	CONSTON ISSUE	LW	ADP
S2 P 6	21.08.24	External repairs works application additions	LW	ADP
D2 P 7	24.10.16	External repairs works application additions rev 01	LW	ADP

Image 1
Thin copper Lightning Protection tubes dropped down on elevations as per locations on drawing above



Image 2
Lightening Protection tape at roof level - refer to A-1005 & suppliers drawings for locations

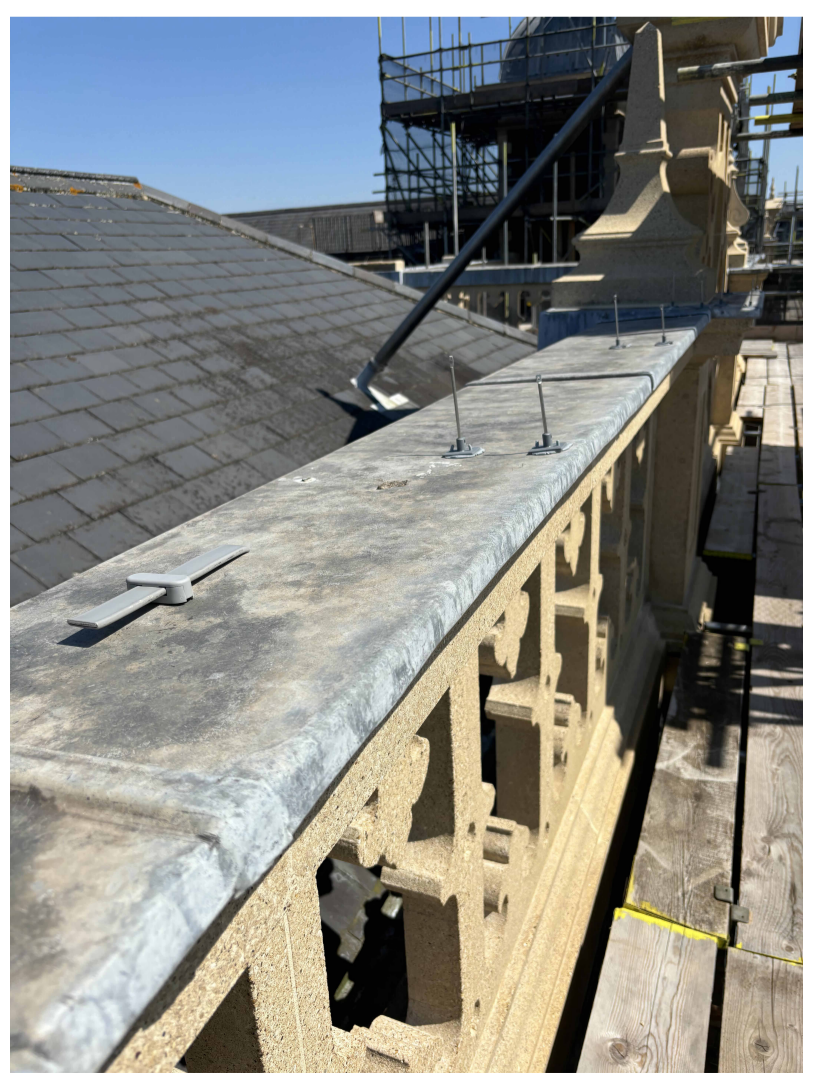

CHECK ALL DIMENSIONS AND VERIFY ON SITE. REPORT ANY ERRORS OR OMISSIONS

adp The Fire Station
 150 Waterloo Road
 London
 SE1 8SB
 T +44 (0) 20 7089 1720
 E london@adp-architecture.com
 www.adp-architecture.com

JOB TITLE:
KNELLER HALL

DRAWING TITLE:
WEST ELEVATION - PROPOSED EXTERNAL REPAIRS

SCALE: 1 : 100	DRAWING SHEET SIZE: A1	
JOB CODE: 001506	DRAWING NUMBER: ADP-01-XX-DR- A-1219	REVISION: D2 P 7