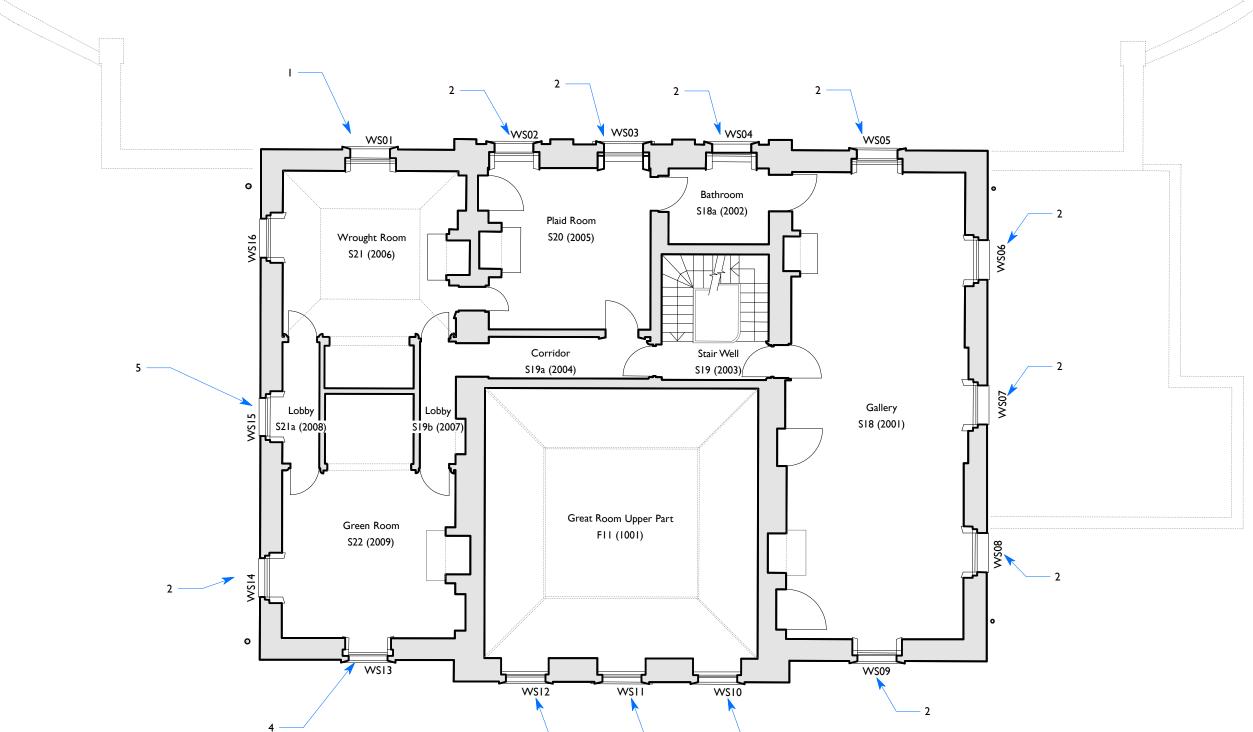## Second Floor Plan Shutter Repair Notes

1. WS01: The pulleys to the lower 'sliding sash shutter' are broken/missing; remove the retaining beads and open up sash box. Install 2no. new sash cords, 2no new pulleys and refix weights. Reassemble window. The upper 'sliding sash shutter' is stiff, allow to ease. If boxing is opened up, allow to refurbish including rebalencing or replacing the sash weights if required.
2. Window shutters and ironmongery appears to be in an acceptable condition. Generally to the 'sliding sash shutter' wax the cords and oil the pulleys.
3. Allow a provisional sum to repair windows WS10,11,12 as required.
4. WS13; 'sliding sash shutter' mechanism is broken and disused. The 'new' shutters are in an acceptable condition. No work required.
5. WS15; the LH sash weight has become detached. Remove the beads, open up the sash box using the access doors, lift out the sashes. Replace the sash cords to both sides and refix/reinstall the sashes, refixing the beads. Generally to the 'sliding sash shutter' wax the cords and oil the pulleys.

Revision	Date	Description
A	1st August 2017	Minor amendment to note, repair information to sash window transfered to drawing 315
B	5th September 2017	Notes amended for planning submission

Second Floor Plan

Room labels:
- Wrought Room S21 (2006)
- Plaid Room S20 (2005)
- Bathroom S18a (2002)
- Corridor S19a (2004)
- Stair Well S19 (2003)
- Lobby S21a (2008)
- Lobby S19b (2007)
- Gallery S18 (2001)
- Green Room S22 (2009)
- Great Room Upper Part F11 (1001)

Window labels: WS01, WS02, WS03, WS04, WS05, WS06, WS07, WS08, WS09, WS10, WS11, WS12, WS13, WS14, WS15, WS16

DRAWING ISSUE STATUS	REVISION N°	DATE	SIGNED
RISK ASSESSMENT UNDERTAKEN			
PLANNING APPLICATION N° 1			
PLANNING APPLICATION N° 2			
PLANNING CONSENT			
LISTED BLDG APPLICATION			
LISTED BLDG CONSENT			
DAC APPROVAL			
BLDG CONTROL APPLICATION			
BLDG CONTROL APPROVAL			
TENDER DOCUMENT			
CONTRACT DOCUMENT			

Scale: 0 1 2 3 4 5 6 7 8 9 10 m

CLIENT
English Heritage

PROJECT
Marble Hill House

TITLE
Main House:
Second Floor Plan; repairs to shutters

Acanthus Clews architects

Acanthus House
57 Hightown Road
Banbury • Oxfordshire
OX16 9BE
Tel: 01295 702600
Fax: 01295 702601
architects@acanthusclews .co.uk
www.acanthusclews .co.uk

SCALE	
1:100 @ A3	
DATE	DRAWN
April 2017	HS
JOB N°	DRAWING N°
16_132	282 B