







### Twickenham Riverside

Arboricultural Impact Assessment

and

Arboricultural Method Statement

For

London Borough of Richmond upon Thames

Project No.: ALP001-008

July 2022





### London & South East

Compass House Surrey Research Park Guildford GU2 7AG . UK t: +44 (0)1483 466 000

### North East

Brooklands Court Business Centre Tunstall Road LS11 5HL. UK **t** +44 (0)113 247 3780

#### North West St James Tower

7 Charlotte Street Manchester M1 4DZ t +44 (0) 161 676 1160

### Wales & South West

Sophia House 28 Cathedral Road Cardiff CF11 9LJ UK

t: +44 (0) 2920 660180

Midlands
605 Holly Court, Holly Farm Business Park
Honiley, Kenilworth Warwickshire CV8 1NP

t: +44 (0) 121 726 3494

### London & South East

Compass House Surrey Research Park Guildford GU2 7AG . UK t +44 (0)1483 466 000

### Enquiries

e: enquiries@thomsonec.com

w: www.thomsonec.com







Project Number	Report No.
ALP001-008	002
(previously AALP152/001)	

Revision No.	Date of Issue	Author	Reviewer	Approver
001	30/07/2021	Andy Poynter	Neil Francis	Simon Mackrell
002	04/03/2022	Andy Poynter	Neil Francis	Simon Mackrell
003	05/07/2022	Andy Poynter	Robert Armitage	Andy Poynter

### Disclaimer:

Copyright Thomson Habitats Limited. All rights reserved.

No part of this report may be copied or reproduced by any means without prior written permission from Thomson Habitats Limited. If you have received this report in error, please destroy all copies in your possession or control and notify Thomson Habitats Limited.

This report has been prepared for the exclusive use of the commissioning party and unless otherwise agreed in writing by Thomson Habitats Limited, no other party may use, make use of or rely on the contents of the report. No liability is accepted by Thomson Habitats Limited for any use of this report, other than for the purposes for which it was originally prepared and provided.

Opinions and information provided in the report are on the basis of Thomson Habitats Limited using due skill, care and diligence in the preparation of the same and no explicit warranty is provided as to their accuracy. It should be noted and it is expressly stated that no independent verification of any of the documents or information supplied to Thomson Habitats Limited has been made.

Summary ......5



## Contents

	2.	Introd	luction	6					
	3.	Arbor	ricultural Impact Assessment (AIA)	8					
	;	3.1	Introduction	8					
	;	3.2	Documents	8					
	;	3.3	Tree Removals	8					
	;	3.4	Trees to be Retained1	1					
	;	3.5	Tree Works1	2					
	į	3.6	Construction Work within RPAs1	2					
	;	3.7	Services and Utilities	3					
	;	3.8	Post Development Management	3					
	į	3.9	New Planting1	3					
	;	3.10	Conclusion1	4					
	4.	Arbor	ricultural Method Statement (AMS)1	6					
		4.1	Introduction1	6					
		4.2	Documents	6					
		4.3	Arboricultural Issues	6					
		4.4	Supervision1	7					
		4.5	List of Contacts	8					
		4.6	Tree Removals and Pruning1	8					
		4.7	Protective Fencing1	8					
		4.8	Removal of Hard Surfaces within the RPA	9					
		4.9	Construction within RPAs	9					
		4.10	Services and Utilities	20					
		4.11	Landscaping	20					
		4.12	Sequence of Works	12					
	5.	Biblio	graphy2	22					
	Appe	endix	1 - Tree Schedule	23					
	Appe	endix	2 - Table of Quality Assessment3	30					
	Appe	endix	3 - Schedule of Tree Works3	31					
	Appe	endix ·	4 - Illustration of pruning for T663	34					
	Appe	endix	5 - Example of Protective Fencing3	35					
	Appe	pendix 6 - Example of Protective Fencing							
	Appe	endix	7 - Tree Protection Fencing Notice						
FIGURE	1:	Sı	TE LOCATION						
FIGURE	2:	Tr	Tree Constraints Plan (TCP01)						
FIGURE	3:	TREE RETENTION AND REMOVAL PLAN (TRRP01)							
FIGURE	4:	TF	REE PROTECTION PLAN (TPP01)						



## 1. Summary

- 1.1.1 Arcadis LLP is involved in the development of a site located at Twickenham Riverside, London. The proposed description of development is as follows:
  - 'Demolition of existing buildings and structures and redevelopment of the site comprising 45 residential units (Use Class C3), ground floor commercial/retail/cafe (Use Class E), public house (Sui Generis), boathouse locker storage, floating pontoon and floating ecosystems with associated landscaping, reprovision of Diamond Jubilee Gardens, alterations to highway layout and parking provision and other relevant works.'
- 1.1.2 Arcadis LLP commissioned Thomson Environmental Consultants (Thomson) to produce an Arboricultural Impact Assessment (AIA) and Arboricultural Method Statement (AMS) detailing the protection of retained trees at the site.
- 1.1.3 An arboricultural survey was previously carried out by Thomson in July 2020 in accordance with BS5837:2012 'Trees in Relation to Design, Demolition and Construction Recommendations' (BS5837:2012), the results of which can be seen in Thomson report reference ALP001-008-001 (Thomson, 2022).
- 1.1.4 A total of 68 individual trees and four groups of trees were recorded (on and offsite) during the survey which are listed in the Tree Schedule (see Appendix 1).
- 1.1.5 46 individual trees and four groups (containing in total, 20 individual trees) within the site will be removed to accommodate the development proposals.
- 1.1.6 Retained trees will be protected through the construction phase by protective fencing, ground protection and the utilisation of arboricultural supervision during certain construction activities.
- 1.1.7 Black poplar tree T34 that was planted to commemorate the Diamond Jubilee will have cuttings taken ahead of removal for propagation. This will facilitate the distribution of the legacy of the tree across the borough.
- 1.1.8 The site will continue to provide public amenity and the proposed tree planting will make a long-term contribution.
- 1.1.9 Within the proposals there are underground soil volumes identified within the landscape strategy. This rooting medium will be delivered through either structural soil or soil cells. Moreover these will be connected beneath ground to provide a suitable reserve for the demanding conditions of the site.
- 1.1.10 The trees identified for retention can be managed and protected during the redevelopment of the site.



### 2. Introduction

### 2.1 Development Background

- 2.1.1 Arcadis LLP is involved in the development of a site located at 1, 1A, 1B and 1C King Street; 2-4 Water Lane; the site of the former swimming pool and associated buildings, The Embankment; the Diamond Jubilee Gardens, Twickenham, London.
- 2.1.2 Arcadis LLP is involved in the development of a site located at Twickenham Riverside, London.
  The proposed description of development is as follows:
  - 'Demolition of existing buildings and structures and redevelopment of the site comprising 45 residential units (Use Class C3), ground floor commercial/retail/cafe (Use Class E), public house (Sui Generis), boathouse locker storage, floating pontoon and floating ecosystems with associated landscaping, reprovision of Diamond Jubilee Gardens, alterations to highway layout and parking provision and other relevant works.'
- 2.1.3 The development is located on an approximately 1.34ha area of land (grid reference TQ163731), shown on Figure 1. The area affected by the development is hereafter referred to as 'the site'.
- 2.1.4 There are trees within the site boundary that will be affected by the development.

### 2.2 Arboricultural Background

- 2.2.1 An arboricultural survey of the site was initially undertaken by Thomson on July 2020. The survey was undertaken in accordance with BS5837:2012. The site was subsequently visited by Andrew Poynter BSc (Hons) FArborA, MICFor, MCIHort on 4<sup>th</sup> May 2021, and more recently on 28<sup>th</sup> April 2022. A final visit on and 27<sup>th</sup> May 2022 to review specific trees was in the company of the council's tree officer Jane Crowther.
- 2.2.2 A total of 68 individual trees and four groups of trees were recorded during the survey which are listed in the Tree Schedule (see Appendix 1). 18 of the trees are offsite. Definitions of each retention category can be seen in Appendix 2.

### 2.3 Brief and Objectives

- **2.3.1** Arcadis LLP commissioned Thomson to produce an AIA and AMS.
- 2.3.2 The objective of the survey and report is to assess the condition of the existing trees on site and any off site trees that might be affected by the development, providing sufficient information to enable decisions to be made on potential design layout and tree retention for the proposed development. The brief was to provide:
  - An Arboricultural Impact Assessment (AIA) which, based on the proposed site layout, evaluates the direct and indirect effects of the proposed design on the trees on site, identifies which trees can realistically be retained, and recommends any necessary mitigation to protect those trees.



- An Arboricultural Method Statement (AMS) detailing how retained trees will be protected on site and how any aspect of the development that is within the root protection areas of retained trees will be implemented with minimum impact on the future health of the trees.
- A Tree Protection Plan detailing how retained trees will be protected during development works.

### Limitations

- 2.3.3 The information provided within this report and in the accompanying Tree Schedule covers only those trees that were inspected and their condition at the time of survey.
- 2.3.4 The Arboricultural Impact Assessment and Method Statement are based on the documents provided and referred to within this report. Further drawings and documents issued by others following this assessment may require the impacts to be reviewed.



## 3. Arboricultural Impact Assessment (AIA)

### 3.1 Introduction

- 3.1.1 The purpose of the AIA is to assess the likely impact of the proposed development on the existing trees on site and to determine which trees are to be removed or retained during the construction phase.
- 3.1.2 The protection of retained trees is paramount to their survival during the development process and their consequent long term contribution to the site. The Root Protection Areas (RPAs) identified in the arboricultural survey and Tree Constraints Plan (TCP) should remain protected throughout the development to avoid potential damage, such as:
  - Soil compaction;
  - Root severance due to excavation;
  - Soil coverage with impermeable material;
  - Alterations in ground level;
  - Leaks and spillages from stored materials; and
  - · Vehicle and heavy plant collision.

### 3.2 Documents

3.2.1 This assessment has been based on documents can be seen in Table 1 below.

Table 1: Documents upon which this assessment has been based

Originator	Reference No.	Title
Hopkins Architects Limited	TRS-HAL-ZZ-00- DR-A- 2500-C02	Proposed Ground Floor GA Plan
LDA	Landscape DAS	Landscape DAS
LDA	Landscape supporting technical drawings	Landscape supporting technical drawings
LDA	6975-103	General Arrangement Tree Pit Plan
Waterwise	WWS-J2132- DWG-001-00	Irrigation system: Areas to be irrigated automatically

### 3.3 Tree Removals

3.3.1 A total of 46 individual trees and four groups (containing in total, 20 individual trees) will be removed as part of the development. A breakdown of the associated categories assigned to these specimens can be seen in Table 2 and the species of tree to be removed in Table 3. They are identified on the Tree Retention and Removal Plan at Figure 3.



Table 2: Number of trees to be removed within each retention category

Removal		Totals			
	Α	A B C		U	Totals
Number of Trees	1	9	20	16	46
Number of Groups	0	3	1	0	4
Total	1	12	21	16	50

Table 3: Details of trees to be removed

Tree Number	Species	Category	Reason
T1	Sycamore; Acer pseudoplatanus	C2	To facilitate development
T2	Sycamore; Acer pseudoplatanus	B2	To facilitate development
T3	Sycamore; Acer pseudoplatanus	C2	To facilitate development
T4	Sycamore; Acer pseudoplatanus	U	For arboricultural reasons
T5	Sycamore; Acer pseudoplatanus	C2	To facilitate development
T6	Sycamore; Acer pseudoplatanus	C2	To facilitate development
T7	Hornbeam; Carpinus betulus	C2	To facilitate development
Т8	Goat willow; Salix caprea	U	For arboricultural reasons
Т9	Sycamore; Acer pseudoplatanus	U	For arboricultural reasons
T10	Sycamore; Acer pseudoplatanus	C2	To facilitate development
T11	Goat willow; Salix caprea	U	For arboricultural reasons
T12	Sycamore; Acer pseudoplatanus	C2	To facilitate development
T13	Goat willow; Salix caprea	C2	To facilitate development
T14	Sycamore; Acer pseudoplatanus	C2	To facilitate development
T15	Sycamore; Acer pseudoplatanus	C2	To facilitate development
T16	Sycamore; Acer pseudoplatanus	C2	To facilitate development
T17	Sycamore; Acer pseudoplatanus	C2	To facilitate development
T18	Silver birch; Betula pendula	U	For arboricultural reasons
T19	Sycamore; Acer pseudoplatanus	C2	To facilitate development
T20	Sycamore; Acer pseudoplatanus	C2	To facilitate development
T21	Goat willow; Salix caprea	U	For arboricultural reasons



Tree Number	Species	Category	Reason		
T22	Sycamore; Acer pseudoplatanus	C2	To facilitate development		
T23	Sycamore; Acer pseudoplatanus	B2	To facilitate development		
T24	Sycamore; Acer pseudoplatanus	C2	To facilitate development		
T25	Sycamore; Acer pseudoplatanus	C2	To facilitate development		
T26	Sycamore; Acer pseudoplatanus	C2	To facilitate development		
T27	Sycamore; Acer pseudoplatanus	C2	To facilitate development		
T28	Sycamore; Acer pseudoplatanus	U	For arboricultural reasons		
T29	Himalayan birch; Betula utilis	B1	To facilitate development		
T30	Himalayan birch; Betula utilis	B1	To facilitate development		
T31	Himalayan birch; Betula utilis	B2	To facilitate development		
T32	Indian bean tree; Catalpa bignoniodes	B1	To facilitate development		
T33	Indian bean tree; Catalpa bignoniodes	B1	To facilitate development		
T34	Black poplar; Populus nigra	В3	To facilitate development		
T35	Hornbeam; Carpinus betulus	U	For arboricultural reasons		
T36	Hornbeam; Carpinus betulus	A1	To facilitate development		
T38	Hornbeam; Carpinus betulus	U	For arboricultural reasons		
T39	Sycamore; Acer pseudoplatanus	C2	To facilitate development		
T58	Pin oak; Quercus palustris	U	For arboricultural reasons		
T59	Pin oak; Quercus palustris	U	For arboricultural reasons		
Т60	Pin oak; Quercus palustris	U	For arboricultural reasons		
T61	Pin oak; Quercus palustris	U	For arboricultural reasons		
T62	Pin oak; Quercus palustris	U	For arboricultural reasons		
T63	Pin oak; Quercus palustris	U	For arboricultural reasons		
T64	Pin oak; Quercus palustris	U	For arboricultural reasons		
T65	Hornbeam; Carpinus betulus	B2	To facilitate development		
G1	Sycamore; Acer pseudoplatanus	C2	To facilitate development		
G2	<b>London plane;</b> Platanus x hispanica	B2	To facilitate development		
G3	<b>London plane;</b> Platanus x hispanica	B2	To facilitate development		
G4	<b>London plane;</b> Platanus x hispanica	B2	To facilitate development		



- 3.3.2 The majority of the trees (T1-T29) to be removed are within the publicly inaccessible hoarded off area where most of the trees appear to be self sown.
- 3.3.3 Black poplar T34 is the most notable tree to be removed as it commemorates the Diamond Jubilee. As mature specimens they are large trees which itself would potentially cause challenges for managing the tree as it would require frequent pruning to reduce the likelihood of limb failure in the busy the public space. The tree would not have the opportunity to reach its full mature potential.
- 3.3.4 The impact of losing this tree was recognised and every opportunity for retention within and off site was explored. These options included moving the tree by road and barge to a site where it would be better suited and have the space to fulfil its mature size. The transport options and potential sites were reviewed in detail on 27th May 2022 by Andrew Poynter, Jane Crowther (Tree Officer) and James Shipman from Civic Trees who are a specialist company that move large trees.
- 3.3.5 Ultimately it proved to be logistically impossible by road or river.
- 3.3.6 The poplar tree will be survived from cuttings taken ahead of removal. The cuttings will be propagated at nurseries that will return them at a size they can be planted across the borough. The quantity and nurseries required will be set out within a planning condition to secure the future of this tree across the borough.

### 3.4 Trees to be Retained

- 3.4.1 Within the red-line boundary there are three trees on the high street (T66-T68) to be retained.
  Within the main project there is one prominent hornbeam (T37) to be retained. There are works close to T37 and T66.
- 3.4.2 Works near hornbeam T37 include the removal of the existing retaining wall and hard surfacing to the south. The adjacent road and retaining will have influenced the distribution of roots but it is unreasonable to expect them to be confined to the raised border alone, so in the absence of trial excavations, it is appropriate to revert to the notionally circular RPA. The area impacted is 41m² or 21% of the notionally circular RPA and following the removal of hard landscape there will be soft landscaping across much of the area providing a better rooting environment for the tree.
- 3.4.3 Oak tree T66 is to have the kerb line realigned which will bring the road nearer to the tree. The tree is surrounded by hard surfacing and highway work in 2016 have not adversely affected the trees growth. The area of the RPA impacted is 29m² or 30% of the notionally circular RPA; however trial excavations have been carried out and inspected by the council's tree officer and no significant roots were found with the existing sub-base structure.
- 3.4.4 There will be pruning required to accommodate the new kerb alignment and this is set out within Table 4 below and illustrated at Appendix 4. The works are to provide sufficient clearance for vehicles and pedestrians. The works were discussed and agreed with the council's tree officer during the site visit on 27th May 2022.



- 3.4.5 With the absence of roots down to the depth required for the kerb realignment, there is no impact from the works expected.
- 3.4.6 There will be a need to have arboricultural supervision whilst works within the RPA are being undertaken.

### 3.5 Tree Works

3.5.1 Prior to the erection of protective fencing, there are two trees (T37 and T66) which, in order to maintain their health and future structural integrity, require some maintenance works. All tree work is to be undertaken in accordance with the British Standard BS3998:2010 Recommendations for Tree Work (BS3998:2010). There are trees to be relocated, this is a specialist operation that will be undertaken by a specialist sub-contractor.

Table 4: Schedule of tree works for on-site trees

Tree No.	Species	Works	Category		
T37	Hornbeam; Carpinus betulus	Crown lift to 4m.	A1		
Т66	Pedunculate Oak; Quercus robur	Crown lift to 5m over carriageway and 3m over footpath	A1		

### 3.6 Construction Work within RPAs

- 3.6.1 The RPAs of the retained trees should be protected by fencing to the specification laid out in BS5837:2012. The specification of this fencing is detailed in Section 4.7 of the AMS and an illustrated example can be seen in Appendix 4. The area protected by the fencing shall be known as the Construction Exclusion Zone (CEZ).
- 3.6.2 Works will be required within the RPAs of tree T37 and protective fencing will be used to protect the integrity of the RPA and prevent soil compaction and root damage. The retaining wall located south of the tree is being removed and the trees will benefit from an increased soil volume provided for within the proposals.
- 3.6.3 The new play area of the proposed development incurs into the RPAs of T37. Providing works are carried out carefully, the installation of the play area should be seen as a positive impact for the trees in the long term as the works involve the removal of the existing retaining walls and reducing the extent of hard surfacing. The hard surfacing will be replaced with a soft and porous play-surface.
- 3.6.4 The high street trees (T66-T68) are remote from the main development, the works in the vicinity is the installation of a new kerb line and resurfacing near oak T66. The impact of these works has been discussed at paragraph 3.4.5.



### 3.7 Services and Utilities

- 3.7.1 The final route of underground services is not available at this time. However, it is anticipated that underground services serving the new development will be routed to avoid the existing trees' RPAs and accommodate the proposed planting.
- 3.7.2 The extent of services within the highways has not been determined but new trees are set back from the highway so there is a reduced likelihood of conflict.
- 3.7.3 If service installation is required within RPAs of any of the five retained trees then the guidelines within National Joint Utilities Group publication 'Guidelines for the planning, installation and maintenance of utility services in proximity to trees' (NJUG 4, 2007) should be adhered to.

### 3.8 Post Development Management

- 3.8.1 As the retained tree T37 is located adjacent to a play area that will be used by the public, it should continue to be regularly inspected by a qualified arboriculturist
- 3.8.2 There are four trees to be retained of which one is located within the Diamond Jubilee Garden. The retained tree and the new trees planted as part of the final landscaping scheme should be integrated into the council's tree management system. Guidance on the level of tree management required can be found in the National Tree Safety Group publication, 'Common sense risk management of trees' (NTSG, 2011).

### 3.9 New Planting

- 3.9.1 The proposed layout indicates a total of 49 new trees to be planted as part of the new landscaping scheme. This level of new planting should be sufficient to compensate for the trees and groups of trees being removed listed in Table 3.
- 3.9.2 It is an opportunity to replace the struggling pin oak trees with species more suitable for the site and its usage. The reasons for the poor condition of the Pin oaks is unclear and it is hoped that this development will provide an opportunity to review the previous installation and, through detailed inspection, along with soil and water testing, understand the factors that have contributed to their condition. These investigations are separate from the planning application but may inform the final species selection.
- 3.9.3 When deciding what tree to plant, the available space above and below ground is often overlooked. Knowing what a tree will look like in 10 and 30 years' time is important as too often trees suffer poor form and stunted growth due to restricted space and conflict with their surroundings. The tree's height, crown spread and root space as it nears maturity should be considered during the tree selection process.
- 3.9.4 Choosing a range of native and non-native tree species suitable to different urban settings will avoid the potential risk of complete and rapid tree loss caused by tree pests, diseases and climate change. Since tree pests and diseases tend to be selective, a varied treescape will usually suffer fewer losses when an outbreak does occur. Frank Santamour (1990) proposed a '10-20-30' formula to develop a diverse tree population no more than 10% of any species, 20%



- of any genus or 30% of any family. This would be almost impossible to apply if limited to just native species.
- 3.9.5 Trees filter pollution and particulates from the air. As the leaf area of a tree increases, so the filtering capacity increases. Deciduous trees are also good at absorbing gases.
- 3.9.6 Areas designated for new tree planting should be suitably prepared, including soil preparation prior to the new trees being planted.
- 3.9.7 For this project there are a number of tree planting areas across the site, and whilst at ground level they appear to be separated in places the design strategy for soil volume connects the various below ground rooting environments to provide a good quantum of rooting medium.
- 3.9.8 There is a mixture of structural soil and cells identified and the use of each will be determined by the specific site use and this is set out on the LDA General Arrangement Tree Pit Plan drawing no. 6975-103. This drawing sets out the minimum requirements based upon the GreenBlue online soil volume calculator (<a href="https://greenblue.com/gb/resources/soil-calculator/">https://greenblue.com/gb/resources/soil-calculator/</a>). The overall strategy seeks to connect as many tree pits together as practically possible.
- 3.9.9 Structural soil is a soil 'recipe' that comprises a high proportion of incompressible aggregate such a stone, gravel and sand. Recipes vary and include Amsterdam soil, Stockholm tree pit soil and Cornell Universitiy's Structural soil (<a href="http://www.hort.cornell.edu/uhi/outreach/pdfs/CU-Structural%20Soil%20-%20A%20Comprehensive%20Guide.pdf">http://www.hort.cornell.edu/uhi/outreach/pdfs/CU-Structural%20Soil%20-%20A%20Comprehensive%20Guide.pdf</a>). As the names suggest, these have been pioneered abroad and are now becoming more widely used in the UK.
- 3.9.10 Soil cells are a crate system that are stacked and connected to essentially create a void, there are a variety of products on the market and GreenBlue provide an overiew of systems (<a href="https://greenblue.com/qb/solutions/soil-cells/">https://greenblue.com/qb/solutions/soil-cells/</a>).
- 3.9.11 Details of new tree planting have been proposed but the site investigation for the failed pin oaks may influence the final species selection.
- 3.9.12 Detailed landscaping plans have been provide by LDA and these are supported by a suit of technical drawings. The landscaping details include irrigation information.
- 3.9.13 Guidance on how newly planted trees can be successfully grown and planted and flourish in their environment without excessive maintenance can be found in British Standard BS8545:2014 " Trees: from nursery to independence in the landscape Recommendations" (BS8545:2014).
- 3.9.14 In advance of the planning application there has been dialogue with the LPA tree officers and this has influenced the proposed tree planting.
- 3.10 Conclusion
- 3.10.1 The development will result in the removal of 46 trees and four groups of trees from the site.

# Arboricultural Impact Assessment and Arboricultural Method Statement Twickenham Riverside



- 3.10.2 The trees proposed for retention can be suitably protected during the construction phase of the development by the erection of protective fencing furnished with tree protection notices, hand excavation and the creation of a Construction Exclusion Zone.
- 3.10.3 Once detailed finalised drawings for the underground services have been produced, they should be reviewed by an arboricultural consultant prior to approval by the Local Planning Authority Tree Officer.



## 4. Arboricultural Method Statement (AMS)

### 4.1 Introduction

- 4.1.1 This AMS sets out the tree protection required to facilitate the proposed development, and should not be read as a definitive engineering or construction statement for this site. Matters relating to construction or engineering detail should be referred to a qualified structural engineer for further information and specification.
- 4.1.2 This AMS is to be used in conjunction with the Tree Protection Plan (TPP01) in Figure 4.

### 4.2 Documents

4.2.1 This AMS has been based on documents listed in Table 5.

Table 5: Documents upon which this assessment has been based

Originator	Reference No.	Title
Hopkins Architects Limited	TRS-HAL-ZZ-00-DR-A- 2500-C02	Proposed Ground Floor GA Plan
LDA	Landscape DAS	Landscape DAS
LDA	Landscape supporting technical drawings	Landscape supporting technical drawings
LDA	6975-103	General Arrangement Tree Pit Plan
Waterwise	WWS-J2132-DWG-001- 00	Irrigation system: Areas to be irrigated automatically

4.2.2 The relationship between the trees and the proposed development are shown on the Tree Protection Plan (TPP01), (see Figure 4) which is based on the Tree Constraints Plan (TCP01) and the drawings detailed in Table 5.

### 4.3 Arboricultural Issues

- 4.3.1 There is a requirement to remove most trees to facilitate this development, as detailed in Appendix 3 of this report. These trees should be removed before construction commences. There are trees to be relocated and these are to stay in situ until they are to be moved to the new location.
- 4.3.2 Access facilitation pruning of the canopies of retained trees, as laid out in Appendix 3, should be completed before construction begins.
- 4.3.3 All drainage, service installations and ground modelling works are to be undertaken outside the Construction Exclusion Zone (CEZ). This will be created by the temporary protective fencing (see Figure 3).



### 4.4 Supervision

- 4.4.1 Before construction commences, a suitably qualified and experienced arboriculturist shall be appointed to oversee key stages of the construction work that will affect the tree, as laid out in Table 11.
- 4.4.2 The arboriculturist shall hold a pre-commencement meeting with the site manager, relevant construction staff and Local Authority Tree Officer (if appropriate) to explain and agree the contents of this AMS to ensure its correct implementation.
- 4.4.3 A site induction will be held for all personnel in relation to site procedures and rules that relate to all retained and protected trees on site, as well as explaining the content of the agreed AMS. Construction staff shall be required to sign and confirm that they fully understand their responsibilities with respect to trees and will abide by these requirements. The Site Manager shall retain copies of the site induction statements for future reference where necessary.
- 4.4.4 Once the tree protection fencing has been installed, it should be checked for integrity by a suitably qualified arboriculturist.
- 4.4.5 During the removal of existing hard surfaces, and the laying of new surfacing and retaining wall within the RPAs of tree T37, arboricultural supervision will be required to ensure that any roots uncovered during excavatory works are not damaged and the soil structure remains uncompromised.
- 4.4.6 Monthly visits should be undertaken by a qualified arboriculturist to ensure the retained trees have not been damaged by construction works and that installed tree protection measures remain intact and positioned in the intended locations.
- 4.4.7 After each site visit by the arboriculturist, a report of the visit shall be submitted to London Borough of Richmond upon Thames Planning Department detailing the result of the visit. Where necessary, this will be supported with photographic evidence highlighting unacceptable practices as well as good site management and tree protection measures.
- 4.4.8 In the event that there is a non-approved incursion into a construction exclusion zone, works on site should be temporarily suspended and the lead arboriculturist consulted. A site visit may be necessary to inspect the affected tree and a report of the incident, including any remedial actions taken, sent to London Borough of Richmond Council Planning Department.
- 4.4.9 Any changes to the nature and sequence of works specified in this AMS regarding the retained trees should be agreed with an arboricultural consultant at least 48 hours before their realisation.



### 4.5 List of Contacts

4.5.1 The list of contacts within Table 10 should be used as reference if any deviations from, or issues with, any part of this AMS arise.

Table 6: List of contact details for relevant parties

Name	Job Title	Organisation	Contact Details			
And Downton	Principal Arb	Thomson Environmental	Andrew.Poynter@thomsonec.com			
Andy Poynter	Consultant	Consultants	-	07824 692620		
David Blythe	B :		david.blythe@arcadis.com			
	Project Manager	Arcadis LLP	0207 812 2000	(0)7770 735545		
	B :		mike.b@hopkins.co.uk			
Mike Burnell	Project Architect	Hopkins Architects	020 7724 1751	-		
Na ani Bassan	One in a Constitution	LDA Danisus	Naomi.Rosser@lda-design.co.uk			
Naomi Rosser	Senior Consultant	LDA Design	020 7467 1470	-		

### 4.6 Tree Removals and Pruning

- 4.6.1 The tree removals, relocations and pruning are set out at Appendix 3. The stumps of the felled trees shall be removed. Trees requiring pruning shall have the works carried out in accordance with BS3998:2010 'Recommendations for Tree Work'.
- 4.6.2 T37 and T38 need to have their crowns lifted to give a minimum clearance of 4m from ground level. This will allow access for machinery used on site without the risk of the trees' crowns being damaged. None of these minor works will have an impact on the local amenity value and long term health of these trees. Trees requiring pruning shall have the works carried out in accordance with BS3998:2010 'Recommendations for Tree Work'.
- 4.6.3 Care is to be taken of the ground around retained trees to make sure that it does not become compacted as a result of tree surgery operations. No equipment or vehicles such as timber excavators, dumpers or cranes should be parked or driven beneath the crowns of any retained trees, to prevent subsequent soil compaction and root death. All arisings are to be removed and the site is to be left in as tidy and orderly manner as possible.

### 4.7 Protective Fencing

4.7.1 Temporary fencing will be erected as indicated on the Tree Protection Plan (TPP01) in Figure 4. The specification for this fencing will be in accordance with the recommendations given in BS5837:2012 'Trees in Relation to Design, Demolition and Construction - Recommendations' (BSI). It will comprise 2.0m high mesh fencing (Heras type panels are a simple, readily available solution) attached to a scaffold framework. Support scaffolds will be attached to the scaffold framework as necessary at an angle of 45 degrees on the side of the trees and anchored by further scaffold poles carefully firmed into the ground. The vertical scaffold tubes will be spaced at a maximum interval of 3m.



- 4.7.2 A diagram illustrating an example of the protective fencing can be seen in Appendix 4.
- 4.7.3 Clear signs will be attached at 4m intervals along the fencing stating 'Tree Protection Area Keep Out'. These should be outward facing and weather protected and maintained for the duration of the works. A suitable sign can be seen in Appendix 7.
- 4.7.4 The area protected by the fence shall be known as the Construction Exclusion Zone (CEZ).
- 4.7.5 The following principles must be maintained within the CEZ:
  - Existing ground levels shall not be altered;
  - No excavation shall occur to avoid root severance;
  - No plant or vehicles shall enter the CEZ;
  - Impermeable surfacing shall not be laid down over soil ('capping');
  - No materials, fuels or chemicals shall be stored within any of these areas;
  - No fires to be lit where flames may reach within 5m of the CEZ;
  - No structures or fixtures of any kind shall be fastened in any way to the trunks of the retained trees;
  - No drainage or irrigation pipes shall be installed within the RPAs of the retained trees; and
  - Any unwanted vegetation shall be removed by hand.
- 4.7.6 The fencing shall remain in place until soft or hard landscape operations require its full or partial removal. No other construction activity will take place within those areas formerly protected by the fence.
- 4.8 Removal of Hard Surfaces within the RPA
- 4.8.1 An area of hard-standing within the RPAs of T37 requires removal as part of the development. To prevent damage to any underlying roots this will be removed by hand where possible. Machinery can be used if necessary to break up and remove larger or more substantial sections of the surface, however the machinery should be footed outside of the RPA or on sections of the surface not yet removed.
- 4.8.2 The existing hard standing that is located within the RPAs of T37, will be removed by hand where possible, taking care not to damage any underlying roots. Removal will begin working from the edge of the hard standing closest to the tree and working backwards from there to prevent the need to work from any areas newly exposed. If machinery is required to remove the hard standing, the same method will be used, with the machinery footed outside of RPAs and on areas of hard standing yet to be removed at all times.
- 4.9 Construction within RPAs
- 4.9.1 There is no requirement to undertake any construction work within the RPAs of any of the retained trees for the main area of development. Only soft and play landscape will be installed.



4.9.2 Works around oak tree T66 will require arboricultural supervision when working near the bottom of the sub-base structure. Trial excavations indicate no roots are present, however it would be prudent to have an arboriculturist available to advise should a root be found during the works.

### 4.10 Services and Utilities

- 4.10.1 All underground services and drainage routes shall be located so that no excavations are required within the RPAs of the retained trees. In this instance, the best route onto the site is along the southern boundary or the north-west corner of the site.
- 4.10.2 In the event that an incursion into an RPA is unavoidable, the installation shall comply with the methods and guidelines detailed in *Guidelines for the Planning, Installation and Maintenance of Utility Services in Proximity to Trees* NJUG 4 (2007). If this does occur, then an arboricultural consultant shall be consulted before any works commence within the RPA to agree the methodology for the excavation.

### 4.11 Landscaping

- 4.11.1 The plans provided show new planting beds within the RPAs of the retained tree T37. In order to prevent damage to the tree's roots, mechanical preparation of the ground in these areas shall not be allowed. Instead, cultivation using suitable hand tools such as trowels will be used to break up the surface of the existing ground and to help with decompaction of the soil structure. The addition of organic matter will also assist with the soil amelioration.
- 4.11.2 In addition, it will also be important to adhere to the principles of the CEZ (as detailed in Section 3.6.5) with particular reference to level changes, root severance and 'capping' with impermeable materials. If impermeable surfaces are to be laid within the RPA of any of the retained trees then they should not cover greater than 20% of the area.



### 4.12 Sequence of Works

4.12.1 A logical sequence of events is to be observed as shown in Table 11.

Table 7: Sequence of works.

Stage	Event	Arboricultural Supervision required
Stage 1	Prestart meeting with LPA Officer, site manager and relevant construction staff. This will include site induction for all personnel.	Yes
Stage 2	Carry out tree removals specified in Section 3.5 and any other necessary tree pruning operations to enable access and siting of site compound building and materials storage.	No
Stage 3	Install Protective Fencing in the position shown on Figure 3, to the specifications given in Section 3.6	No
Stage 4	Install site compound, building and materials storage facility.	No
Stage 5	Site visit by arboriculturist to sign off the installed fencing and ground protection. Further regular visits will be undertaken by the arboriculturist.	Yes
Stage 6	Complete main construction phase of development. Supervision of works around T37 and T66. Monthly visits to check tree protection measures.	Yes
Stage 7	Complete all the landscaping.	No
Stage 8	Removal of all machinery from site.	No
Stage 9	Dismantle protective fencing by hand and remove from site.	No
Stage 10	Arboricultural assessment of retained trees on site to confirm their health post development.	Yes



## 5. Bibliography

- **5.1.1** British Standards Institution (2014) BS8545:2014 *Trees: from nursery to independence in the landscape Recommendations.* BSI, London.
- 5.1.2 British Standards Institution (2012) BS5837:2012 *Trees in Relation to Design, Demolition and Construction Recommendations.* BSI, London.
- 5.1.3 British Standards Institution (2010) BS3998:2010 Recommendations for tree work. BSI, London.
- 5.1.4 British Standards Institution (2005) *Publicly Available Specification 100 (PAS 100:2005)*. BSI, London.
- 5.1.5 HM Government. The Town and Country Planning (Tree Preservation) (England) Regulations 2012. London: Office of Public Sector Information (OPSI).
- 5.1.6 Lonsdale, D. (1990) *Principles of Tree Hazard Assessment and Management*. The Stationery Office, London.
- 5.1.7 Matheny, N. & Clark, J.R. (1998) *Trees and Development*. ISA, Champaign, IL.
- **5.1.8** Mattheck, C. & Breloer, H. (1994) *The Body Language of Trees.* The Stationery Office, London.
- 5.1.9 Johnson, O. & More, D. (2004) Collins Tree Guide. London: HarperCollins
- 5.1.10 National Joint Utilities Group (NJUG) (2007) *Guidelines for the planning, installation and maintenance of utility services in proximity to trees.* NJUG, London.
- 5.1.11 National Tree Safety Group (2011) *Common Sense Risk Management of Trees* Forestry Commission, Edinburgh
- **5.1.12** Robertson, J, Jackson, N & Smith, M (2006) *Tree Roots in the Built Environment.* The Stationery Office, London.
- 5.1.13 Santamour, F.S. (2002) *Trees for urban planting: diversity uniformity, and common sense*. U.S. Department of Agriculture. Washington D.C.
- 5.1.14 Urban Horiculture Institute (2015) *CU-Structural Soil A Comprehensive Guide*. Cornell University



# Appendix 1 - Tree Schedule

Tree/ Group No.	Species	Height (m)	Stem Diameter (mm)	Ca N	anopy S	Spread (i	m) W	Height of Lowest Limb and Direction (m)	Crown Clearance (m)	Age Class	Estimated Remaining Contribution (years)	Con Physiology	ndition Structure	Comments	Preliminary Management Recommendations	BS Category	RPA (m²)	RPA Radius (m)
T1	<b>Sycamore</b> ; Acer pseudoplatanus	10	240, 140, 90	2	5	5	3	2.5SW	3	Middle- aged	10+	Fair	Fair	Variegated variety.  Multistemmed from base with included unions. Ivy to 2/3 height. One sided canopy due to competition. Has been raised before.	Remove ivy and reduce/ remove smaller stems.	C2	38.6	3.6
T2	<b>Sycamore</b> ; Acer pseudoplatanus	10	250	5	2	4.5	3.5	2W	1.5	Middle- aged	20+	Good	Good	Uneven canopy due to competition, thin growth to the north. Has been raised before, leaving dead pegs. Deadwood in lower canopy. In close proximity to top of retaining wall.	Remove deadwood and pegs.	B2	28.3	3
ТЗ	<b>Sycamore</b> ; Acer pseudoplatanus	11	260	2.5	2.5	4	5	2.5W	3.5	Middle- aged	10+	Fair	Good	Uneven canopy due to competition. Deadwood in canopy. Ivy to 1/3 height. Close to concrete swimming pool edge.	Remove ivy and deadwood	C2	30.6	3.2
T4	Sycamore; Acer pseudoplatanus	7	80	0	0	0	0	-	0	Young	<10	Dead	Poor	Dead tree	Fell to ground level	U	-	-
T5	Sycamore; Acer pseudoplatanus	8	80	4	2	2	4	0.5W	1	Young	10+	Fair	Fair	Very poor form. Suppressed tree. Close to concrete pool at base. Sparse canopy.	-	C2	6.6	1.5
Т6	<b>Sycamore</b> ; Acer pseudoplatanus	10	150, 200, 200	5	2	4	4.5	15	1	Middle- aged	10+	Fair	Fair	Very poor form. Suppressed tree. Close to concrete pool at base. Sparse canopy. Ivy to 1/4 height.	Remove ivy	C2	46.4	3.9
Т7	Hornbeam; Carpinus betulus	5	90	2	0	0	0	1E	1	Young	20+	Good	Fair	Suppressed tree. Close to concrete pool at base. Sparse canopy. Ivy to 1/2 height.	Remove ivy	C2	3.7	1.1
Т8	Goat willow; Salix caprea	7	160	0	0	0	0	1W	1	Over- mature	<10	Poor	Hazardous	Nearly dead, collapsed coppice. Close to concrete pool at base. One stem is alive still.	Fell to ground level	U	-	-



								Height of Lowest			Estimated Remaining				Preliminary Management			RPA
Tree/ Group No.	Species	Height (m)	Stem Diameter (mm)	N C	anopy S	Spread (	m) W	Limb and Direction (m)	Crown Clearance (m)	Age Class	Contribution (years)	Cor Physiology	ndition Structure	Comments	Recommendations	BS Category	RPA (m²)	Radius (m)
Т9	<b>Sycamore</b> ; Acer pseudoplatanus	9	90	3.5	0	0	3	45	3	Young	<10	Poor	Poor	Suppressed tree. Close to concrete pool at base. Sparse canopy. Damaged at 1m by scrap metal leaning on stem. Wilted foliage.	-	U	-	-
T10	<b>Sycamore</b> ; Acer pseudoplatanus	15	300	3	2	4	4	5NW	6	Mature	20+	Good	Fair	No lower canopy. Close to concrete pool at base. Sparse canopy. Ivy to 2/3 height.	Remove ivy.	C2	40.7	3.6
T11	Goat willow; Salix caprea	8.5	150	0	0	0	0	-	0	Middle- aged	<10	Dead	Hazardous	Held with ivy to live tree.	Fell to ground level	U	-	-
T12	<b>Sycamore</b> ; Acer pseudoplatanus	14	268	0	6	3.5	0	2NW	4.5	Middle- aged	10+	Good	Fair	Canopy competition. Close to concrete pool at base.	-	C2	32.5	3.3
T13	Goat willow; Salix caprea	10	290	1	6	3	1	4SE	4.5	Mature	10+	Poor	Fair	Deadwood in canopy. Close to concrete pool at base. Sparse canopy. Swept leaning stem se from ground level.	Remove deadwood	C2	38.0	3.5
T14	<b>Sycamore</b> ; Acer pseudoplatanus	15	250	1	4	1	5	4NW	3.5	Middle- aged	10+	Fair	Fair	No lower canopy. Close to concrete pool at base. Sparse canopy. Twin stem from 1.7m included union. Deadwood in canopy.	Remove deadwood.	C2	28.3	3
T15	<b>Sycamore</b> ; Acer pseudoplatanus	12	180	3	6	0	0	3NE	2	Middle- aged	10+	Fair	Fair	No lower canopy. Close to concrete pool at base. Sparse canopy. Suppressed leaning tree.	-	C2	14.7	2.2
T16	<b>Sycamore</b> ; Acer pseudoplatanus	14	220	3	5	2	4	5N	2	Middle- aged	10+	Good	Fair	Close to concrete pool at base. Sparse canopy. Canopy competition.	-	C2	21.9	2.7
T17	<b>Sycamore</b> ; Acer pseudoplatanus	13	220, 130	3	5	3	1	4NE	2.5	Middle- aged	10+	Good	Fair	Close to concrete pool at base. Canopy competition. Smaller stem is growing through railings. Almost no foliage on it.	Remove smaller stem	C2	29.5	3.1
T18	Silver birch; Betula pendula	11	160	1	4.5	1	1	6E	6	Middle- aged	<10	Poor	Fair	Close to concrete pool at base. Canopy competition. Very low vigour. Many dead branches. Leaning suppressed tree.	Fell to ground level	U	-	-
T19	Sycamore; Acer pseudoplatanus	15	270	3.5	5	3	4.5	2.5E	3	Middle- aged	10+	Good	Fair	Grown through paving. Canopy competition. Ivy filled.	Remove ivy.	C2	33.0	3.3



Tree/ Group No.	Species	Height (m)	Stem Diameter (mm)	C	anopy S	Spread (I	n) W	Height of Lowest Limb and Direction (m)	Crown Clearance (m)	Age Class	Estimated Remaining Contribution (years)	Coi Physiology	ndition Structure	Comments	Preliminary Management Recommendations	BS Category	RPA (m²)	RPA Radius (m)
T20	<b>Sycamore</b> ; Acer pseudoplatanus	9	100	1	0	0	0	2.5E	2.5	Young	10	Good	Fair	No lower canopy. Suppressed tree.	-	C2	4.5	1.2
T21	Goat willow; Salix caprea	8	280	0	0	2	5	1.7NE	3.5	Mature	<10	Poor	Poor	Mainly dead 1.7m pollard. lvy filled.	Fell to ground level	U	35.5	3.4
T22	Sycamore; Acer pseudoplatanus	14	260	4.5	5.5	4	1	2NE	2.5	Mature	20+	Good	Good	Root girdling. Ivy to 1/3 height. Suppressed one sided tree.	Remove ivy.	C2	30.6	3.2
T23	<b>Sycamore</b> ; Acer pseudoplatanus	15	360	5	5	5	5	3.5N	3	Mature	20+	Good	Good	Ivy to 1/3 height. Close proximity to retaining wall. Fence is fixed to stem.	Remove ivy. Repair fence and remove nails from tree.	B2	58.6	4.4
T24	<b>Sycamore</b> ; Acer pseudoplatanus	10	140	2	1	1	2	3W	3	Young	10	Good	Fair	Suppressed tree	Fell to remove competition from b2 tree	C2	8.9	1.7
T25	<b>Sycamore</b> ; Acer pseudoplatanus	12	220	0	3	3	3	3W	3	Middle- aged	10+	Good	Fair	Suppressed tree. Ivy filled	Remove ivy	C2	21.9	2.7
T26	<b>Sycamore</b> ; Acer pseudoplatanus	9.5	150	0	0	2.5	4	6W	4	Young	10	Good	Fair	Suppressed tree. Leaning west. Minimal canopy.	-	C2	10.2	1.9
T27	<b>Sycamore</b> ; Acer pseudoplatanus	16	250	5	4	2	5	5N	4	Mature	10+	Good	Fair	One sided canopy.	-	C2	28.3	3
T28	<b>Sycamore</b> ; Acer pseudoplatanus	9	290	0	0	0	0	-	4	Mature	< 10	Poor	Hazardous	Has failed at base and fallen into other trees.	Remove tree	U	38.0	3.5
T29	Himalayan birch; Betula utilis	7	120	2.5	2.5	2.5	2.5	1.5N	1	Young	20+	Good	Good	-	-	B1 2	6.5	1.5
T30	Himalayan birch; Betula utilis	7	140	2.5	2.5	2.5	2.5	1.5SE	1	Young	20+	Good	Good	-	-	B1 2	8.9	1.7
T31	Himalayan birch; Betula utilis	7	120	2	2	2	2	2NW	1	Young	20+	Good	Good	-	-	B2	6.5	1.5
T32	Indian bean tree; Catalpa bignoniodes	9	290	5	5	5	5	2SE	1	Mature	20+	Good	Good	Scattered small deadwood. Has been reduced before.	-	B1 2	38.0	3.5
Т33	Indian bean tree; Catalpa bignoniodes	9	350	5	5	5	5	1.5W	1	Mature	20+	Good	Good	Scattered small deadwood. Has been reduced before. Low limbs on west side have been broken.	Remove torn pegs of low limbs.	B1 2	55.4	4.3



Tree/ Group No.	Species	Height (m)	Stem Diameter (mm)	C N	anopy S E	Spread (1 S	m) W	Height of Lowest Limb and Direction (m)	Crown Clearance (m)	Age Class	Estimated Remaining Contribution (years)	Con Physiology	dition Structure	Comments	Preliminary Management Recommendations	BS Category	RPA (m²)	RPA Radius (m)
T34	Black poplar; Populus nigra	13	260	3	3	3	3	2.5SE	1.5	Young	10+	Fair	Fair	Evidence of wet-rot decay at old pruning wound. Exudate down stem.  Planted by HRH Princess  Alexandra for Diamond  Jubilee.	-	B1 2 3	30.6	3.2
T35	Hornbeam; Carpinus betulus	15	550	4.5	5.5	4.5	3.5	3.5SE	2.5	Mature	10+	Fair	Fair	Bark necrosis on main stem. Dead stubs from old pruning operations in canopy. Deadwood in canopy. Thin low vigour growth over road.	-	B2	136.8	6.7
T36	Hornbeam; Carpinus betulus	15	510	5	5	5	5	OS	0	Mature	40+	Good	Good	Bark necrosis on main stem. Dead has been raised before. Small deadwood in canopy. Basal growth	Remove basal growth.	A1 2	117.7	6.2
T37	Hornbeam; Carpinus betulus	15	650	5.5	5.5	5.5	5.5	2.5S	2	Mature	40+	Good	Good	Ivy covered stem. Scattered deadwood in canopy. Has been raised before. Roots restricted by retaining wall to the north. Some damage to surface roots.	Remove ivy. Mulch to protect roots.	A1 2	191.1	7.8
T38	Hornbeam; Carpinus betulus	15	570	4.5	4.5	4.5	4.5	2.5W	2	Mature	10+	Poor	Poor	Large area of bark necrosis ground to 2m up stem. Low vigour patchy canopy. Scattered patchy deadwood in canopy. Has been raised before. Minimal rooting area.	Remove deadwood. Mulch.	B2	147.0	6.9
T39	<b>Sycamore</b> ; Acer pseudoplatanus	11	280	3.5	3.5	3.5	3.5	-	4	Middle- aged	10+	Fair	Fair	No access measurements are estimated. Growing between gap in brick structures. Stem not visible below 4.5m.	-	C2	35.5	3.4
T40	Italian alder; Alnus cordata	16	530	4.5	4.5	4.5	4.5	3S	1.5	Mature	20+	Good	Good	-	-	A2	127.1	6.4
T41	Italian alder; Alnus cordata	165	460	5	5	5	5	3.5S	1.5	Mature	40+	Good	Good	-	-	A1 2	95.7	5.6
T42	Whitebeam; Sorbus aria	9	280	3.5	4	2	0	2.5NE	1.5	Mature	10+	Fair	Good	Suppressed one side tree. Deadwood.	Remove deadwood.	B2	35.5	3.4



Tree/ Group No.	Species	Height (m)	Stem Diameter (mm)	C	anopy S	Spread (	m) W	Height of Lowest Limb and Direction (m)	Crown Clearance (m)	Age Class	Estimated Remaining Contribution (years)	Cond Physiology	dition Structure	Comments	Preliminary Management Recommendations	BS Category	RPA (m²)	RPA Radius (m)
T43	<b>Sycamore</b> ; Acer pseudoplatanus	9.5	300	3.5	3.5	3.5	3.5	-	1.5	Mature	10+	Fair	Fair	No access estimated measurements. Managed pollard.	-	B2	40.7	3.6
T44	False acacia; Robinia pseudoacacia	16	610	6	6	6	6	2SW	1.5	Mature	20+	Fair	Fair	Historical large tear out wound from 2m to ground. Scattered deadwood. Has been reduced before.	Raise over footpath. Remove deadwood.	B2	168.3	7.4
T45	Weeping willow; Salix x sepulcralis 'Chrysocoma'	15	700	7	5	2	6	5E	2	Mature	20+	Good	Fair	History of large snap outs. Has been heavily reduced.	-	A2	221.7	8.4
T46	Weeping willow; Salix x sepulcralis 'Chrysocoma'	15	790	4.5	6	6	6.5	2.5E	2.5	Mature	20+	Good	Fair	History of large snap outs. Has been heavily reduced.	Raise over road.	A2	282.3	9.5
T47	Pin oak; Quercus palustris	10	250	3.5	3.5	3.5	3.5	2.5E	1.5	Middle- aged	20+	Fair	Fair	Strong excurrent shape. Low vigour.	Raise over road and footpath	B1 2	28.3	3
T48	Pin oak; Quercus palustris	8.5	200	3.5	3.5	3.5	3.5	2.52	1.5	Middle- aged	10+	Fair	Fair	Strong excurrent shape. Low vigour. Die back at top.	Raise over road and footpath. Remove deadwood.	B1 2	18.1	2.4
T49	<b>Sycamore</b> ; Acer pseudoplatanus	14	400	5	5	5	5	-	1.5	Mature	10+	Good	Fair	No access estimated measurements. Pollard form	-	В2	72.4	4.9
T50	<b>Sycamore</b> ; Acer pseudoplatanus	10	280	4	4	4	4	-	2	Middle- aged	10+	Good	Fair	No access estimated measurements.	-	B2	35.5	3.4
T51	Sycamore; Acer pseudoplatanus	15	350	3	3	7	4.5	-	0	Mature	20+	Fair	Fair	No access estimated measurements. One side canopy. Has been reduced before. Sparse canopy.	-	B2	55.4	4.3
T52	Ash; Fraxinus excelsior	15.5	400	6	4.5	6	5	-	1.5	Mature	20+	Fair	Fair	No access estimated measurements.	Raise over footpath.	B2	72.4	4.9
T53	<b>Sycamore</b> ; Acer pseudoplatanus	6.5	140	2.5	2.5	2.5	2.5	2.5SW	1.5	Young	10+	Good	Good	No access estimated measurements.	Raise over carpark	C2	8.9	1.7
T54	False cypress species; Chamaecyparis sp.	11	200	2	2	2	2	-	0	Middle- aged	10+	Poor	Fair	No access estimated measurements. Very sparse foliage. Very low vigour.	-	C2	18.1	2.4
T55	Domestic apple; Malus domestica	4	280	0	0	0	0	-	0	Mature	<10	Dead	Poor	No access estimated measurements.	Fell	U	35.5	3.4



Tree/ Group No.	Species	Height (m)	Stem Diameter (mm)	C.	anopy S	Spread (	m) W	Height of Lowest Limb and Direction (m)	Crown Clearance (m)	Age Class	Estimated Remaining Contribution (years)	Cone Physiology	dition Structure	Comments	Preliminary Management Recommendations	BS Category	RPA (m²)	RPA Radius (m)
T56	Domestic apple; Malus domestica	6.5	280	2	2	2	2	-	0	Mature	10+	Good	Fair	No access estimated measurements.	-	C2	35.5	3.4
T57	Elder; Sambucus nigra	6.5	200	2.5	2.5	2.5	2.5	-	0	Mature	10+	Fair	Fair	No access estimated measurements.	-	C2	18.1	2.4
T58	Pin oak; Quercus palustris	9	200	3.5	3.5	3.5	3.5	2SW	1.5	Middle- aged	10+	Fair	Fair	Strong excurrent shape. Low vigour.	Raise over road and footpath.	B1 2	18.1	2.4
T59	Pin oak; Quercus palustris	9	210	3.5	3.5	3.5	3.5	2.5\$	1.5	Middle- aged	10+	Fair	Fair	Strong excurrent shape. Low vigour. Dieback at top. Root girded.	Clear stem of regrowth.	B1 2	20.0	2.6
T60	Pin oak; Quercus palustris	8.5	220	3.5	3.5	3.5	3.5	2.5\$	1.5	Middle- aged	10+	Fair	Fair	Strong excurrent shape. Low vigour. Dieback at top.	Clear stem of regrowth.	B1 2	21.9	2.7
T61	Pin oak; Quercus palustris	8	200	3.5	3.5	3.5	3.5	2.5\$	1.5	Middle- aged	10+	Fair	Fair	Excurrent shape. Low vigour. Dieback at top.	-	B1 2	18.1	2.4
T62	Pin oak; Quercus palustris	9	200	3.5	3.5	3.5	3.5	2.5\$	1.5	Middle- aged	10+	Fair	Fair	Excurrent shape. Low vigour dieback at top.	-	B1 2	18.1	2.4
T63	Pin oak; Quercus palustris	8	220	3.5	3.5	3.5	3.5	2.5\$	1.5	Middle- aged	10+	Fair	Fair	Excurrent shape. Dieback at top.	-	B1 2	21.9	2.7
T64	Pin oak; Quercus palustris	8	240	3.5	3.5	3.5	3.5	2.5S	1.5	Middle- aged	10+	Fair	Fair	Excurrent shape. Dieback at top.	Remove deadwood	B1 2	26.1	2.9
T65	Hornbeam; Carpinus betulus	7	140	2	2	2	2	1.5S	1.5	Middle- aged	20+	Good	Good	-	-	B2	8.9	1.7
T66	Pedunculate Oak; Quercus robur	11	460	5	7	6	6	2NW	1.5	Middle- aged	40+	Good	Good	Locally prominent tree on high street.	-	A1	95.7	5.6
Т67	Callery pear; Pyrus calleryana	5	110	1	1	1	1	1.5W	1.5	Young	10+	Fair	Fair	Established tree although sparse crown compared to adjacent tree.	-	C1	5.5	1.32
Т68	Callery pear; Pyrus calleryana	5	90	1	1	1	1	1.5N	1.5	Young	10+	Good	Fair	Satisfactory condition	-	C1	3.7	1.1
G1	Sycamore; Acer pseudoplatanus	11	150	3	3	3	3	3	-	Middle- aged	10+	Fair	Fair	Group of low value ivy filled sycamore. Suppressed poor formed trees.	-	C2	-	-



Tree/ Group No.	Species	Height (m)	Stem Diameter (mm)	C: N	anopy §	Spread (i	m) W	Height of Lowest Limb and Direction (m)	Crown Clearance (m)	Age Class	Estimated Remaining Contribution (years)	Cond Physiology	dition Structure	Comments	Preliminary Management Recommendations	BS Category	RPA (m²)	RPA Radius (m)
G2	London plane; Platanus x hispanica	5.5	160	2	2	2	2	2	-	Middle- aged	20+	Good	Good	Group of pleached plane trees	Continue formal pruning programme. Remove basal growth.	B2	-	-
G3	London plane; Platanus x hispanica	5.5	160	2	2	2	2	2	-	Middle- aged	20+	Good	Good	Group of pleached plane trees	Continue formal pruning programme. Remove basal growth.	B2	-	-
G4	London plane; Platanus x hispanica	5.5	160	2	2	2	2	2	1.5	Middle- aged	20+	Good	Good	Group of pleached plane trees	Continue formal pruning programme. Remove basal growth.	B2	-	-



# Appendix 2 - Table of Quality Assessment

Category and definition	Criteria (including subcate	egories where appropriate)		Identification on plan
Trees unsuitable f	or retention (see Note)			
Category U Those in such a condition that they cannot be retained as living trees in the context of the current land use for longer than 10 years	expected due to collapse other category U trees cannot be mitigated by Trees that are dead or overall decline Trees infected with pat nearby, or very low quar	s, irremediable, structural defects, se, including those that will becom (e.g. where, for whatever reason, pruning) are showing signs of significant, in hogens of significance to the healt ality trees suppressing adjacent tre have existing or potential conserv	e unviable after removal of the loss of companion shelter nmediate and irreversible th and/or safety of other trees ses of better quality	DARK RED
	Mainly arboricultural values	2 Mainly landscape values	3 Mainly cultural values, including conservation	
Trees to be consid	lered for retention			
Category A Trees of high quality with an estimated remaining life expectancy of at least 40 years	Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups or of formal or semi-formal arboricultural features (e.g. the dominant and/or principle trees within an avenue)	Trees, groups or woodlands of particular visual importance as arboricultural and/or landscape features	Trees, groups or woodlands of significant conservation, historical commemorative or other value (e.g. veteran trees or wood-pasture)	LIGHT GREEN
Category B Trees of moderate quality with an estimated remaining life expectancy of at least 20 years	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remediable defects, including unsympathetic past management and storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation	Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals; or trees occurring as collectives but situated so as to make little visual contribution to the wider locality	Trees with material conservation or other cultural value	MID BLUE
Category C Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150mm	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories	Trees present in groups or woodlands, but without this conferring on them significantly greater landscape value; and/or trees offering low or only temporary/transient landscape benefits	Trees with no material conservation or other cultural value	GREY



# Appendix 3 - Schedule of Tree Works

Tree No.	Species	Works	Reason
T1	<b>Sycamore</b> ; Acer pseudoplatanus	Remove.	To facilitate development
T2	<b>Sycamore</b> ; Acer pseudoplatanus	Remove.	To facilitate development
ТЗ	<b>Sycamore</b> ; Acer pseudoplatanus	Remove.	To facilitate development
T4	<b>Sycamore</b> ; Acer pseudoplatanus	Remove.	For arboricultural reasons
T5	<b>Sycamore</b> ; Acer pseudoplatanus	Remove.	To facilitate development
Т6	<b>Sycamore</b> ; Acer pseudoplatanus	Remove.	To facilitate development
Т7	Hornbeam; Carpinus betulus	Remove.	To facilitate development
Т8	<b>Goat willow</b> ; Salix caprea	Remove.	For arboricultural reasons
Т9	<b>Sycamore</b> ; Acer pseudoplatanus	Remove.	For arboricultural reasons
T10	<b>Sycamore</b> ; Acer pseudoplatanus	Remove.	To facilitate development
T11	<b>Goat willow</b> ; Salix caprea	Remove.	For arboricultural reasons
T12	<b>Sycamore</b> ; Acer pseudoplatanus	Remove.	To facilitate development
T13	<b>Goat willow</b> ; Salix caprea	Remove.	To facilitate development
T14	<b>Sycamore</b> ; Acer pseudoplatanus	Remove.	To facilitate development
T15	<b>Sycamore</b> ; Acer pseudoplatanus	Remove.	To facilitate development
T16	<b>Sycamore</b> ; Acer pseudoplatanus	Remove.	To facilitate development
T17	<b>Sycamore</b> ; Acer pseudoplatanus	Remove.	To facilitate development
T18	<b>Silver birch</b> ; Betula pendula	Remove.	For arboricultural reasons
T19	<b>Sycamore</b> ; Acer pseudoplatanus	Remove.	To facilitate development
T20	Sycamore; Acer pseudoplatanus	Remove.	To facilitate development
T21	Goat willow; Salix caprea	Remove.	For arboricultural reasons




Tree No.	Species	Works	Reason
T22	<b>Sycamore</b> ; Acer pseudoplatanus	Remove.	To facilitate development
T23	Sycamore; Acer pseudoplatanus	Remove.	To facilitate development
T24	Sycamore; Acer pseudoplatanus	Remove.	To facilitate development
T25	Sycamore; Acer pseudoplatanus	Remove.	To facilitate development
T26	Sycamore; Acer	Remove.	To facilitate development
T27	pseudoplatanus Sycamore; Acer	Remove.	To facilitate development
T28	pseudoplatanus <b>Sycamore</b> ; Acer	Remove.	For arboricultural reasons
T29	pseudoplatanus Himalayan birch; Betula		
	utilis Himalayan birch; Betula	Remove.	To facilitate development
T30	utilis Himalayan birch; Betula	Remove.	To facilitate development
T31	utilis	Remove.	To facilitate development
T32	Indian bean tree; Catalpa bignoniodes	Remove.	To facilitate development
T33	Indian bean tree; Catalpa bignoniodes	Remove.	To facilitate development
T34	Black poplar; Populus nigra	Remove.	To facilitate development
T35	Hornbeam; Carpinus betulus	Remove.	For arboricultural reasons
T36	Hornbeam; Carpinus betulus	Remove.	To facilitate development
T38	Hornbeam; Carpinus betulus	Remove.	For arboricultural reasons
T39	Sycamore; Acer pseudoplatanus	Remove.	To facilitate development
T58	Pin oak; Quercus palustris	Remove.	For arboricultural reasons
T59	Pin oak; Quercus palustris	Remove.	For arboricultural reasons
T60	Pin oak; Quercus palustris	Remove.	For arboricultural reasons
T61	Pin oak; Quercus	Remove.	For arboricultural reasons
T62	palustris Pin oak; Quercus	Remove.	For arboricultural reasons
	palustris		1



Tree	Omasias	Manla	D
No.	Species	Works	Reason
T63	<b>Pin oak</b> ; Quercus palustris	Remove.	For arboricultural reasons
T64	<b>Pin oak</b> ; Quercus palustris	Remove.	For arboricultural reasons
T65	<b>Hornbeam</b> ; Carpinus betulus	Remove.	To facilitate development
G1	<b>Sycamore</b> ; Acer pseudoplatanus	Remove.	To facilitate development
G2	<b>London plane;</b> Platanus x hispanica	Remove.	To facilitate development
G3	<b>London plane;</b> Platanus x hispanica	Remove.	To facilitate development
G4	<b>London plane;</b> Platanus x hispanica	Remove.	To facilitate development
		Pruning/Relocation	
T37	Hornbeam; Carpinus betulus	Crown lift to 4m.	To allow for works beneath crown
T66	Pedunculate Oak; Quercus robur	(Agreed on site with tree officer). Crown lift to 5m over carriageway and 3m over footpath. Lateral reduction on north eastern midcrown of 1.0-1.5m over Water Lane.	To allow for works, pedestrians and traffic beneath crown




## Appendix 4 - Illustration of pruning for T66

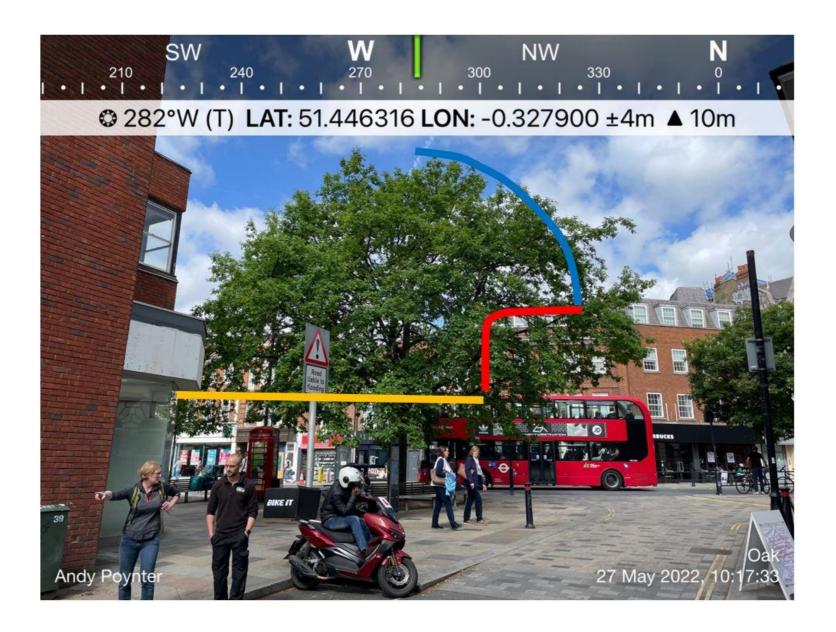


**Appendix 4:** Illustrated pruning for T66: Yellow indicates crown lifting to 3m of pavement; red is pruning to 5m over highway; and blue is light crown reduction between 1.0 and 1.5m to mid north-east crown to improve asymmetry following the crown lifting works.




## Appendix 5 - Example of Protective Fencing

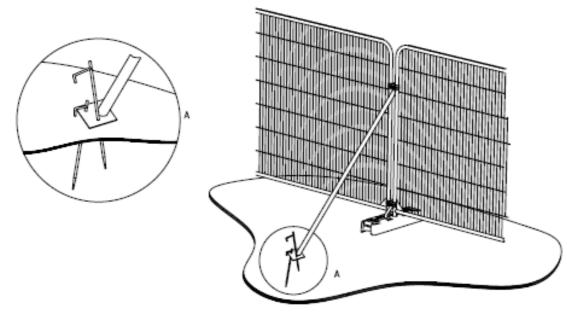

a) Stabilizer strut with base plate secured with ground pins

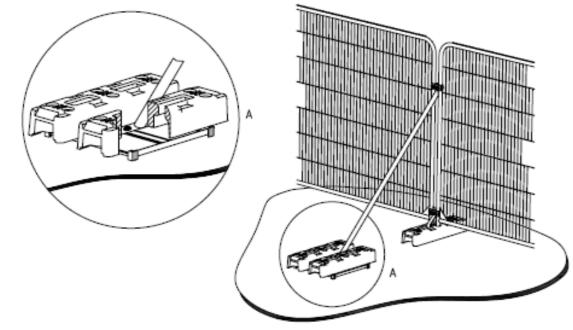

b) Stabilizer strut mounted on block tray

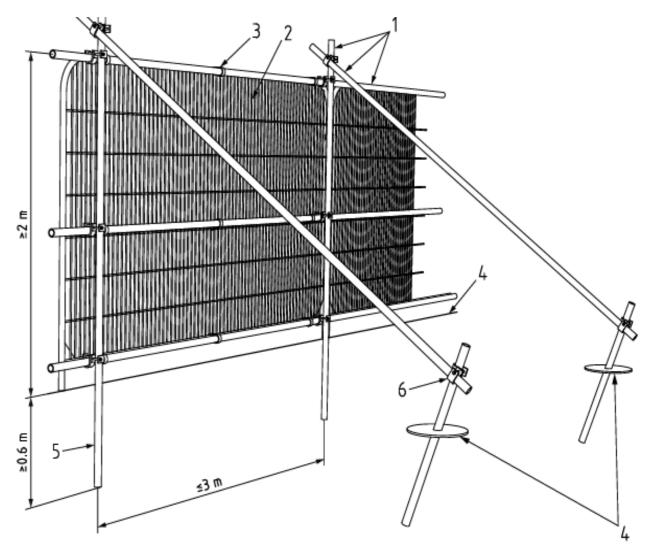


### Key

- 1 Standard scaffold poles
- 2 Heavy gauge 2 m tall galvanized tube and welded mesh infill panels
- 3 Panels secured to uprights and cross-members with wire ties
- 4 Ground level
- 5 Uprights driven into the ground until secure (minimum depth 0.6 m)
- 6 Standard scaffold clamps



## Appendix 6 - Example of Protective Fencing

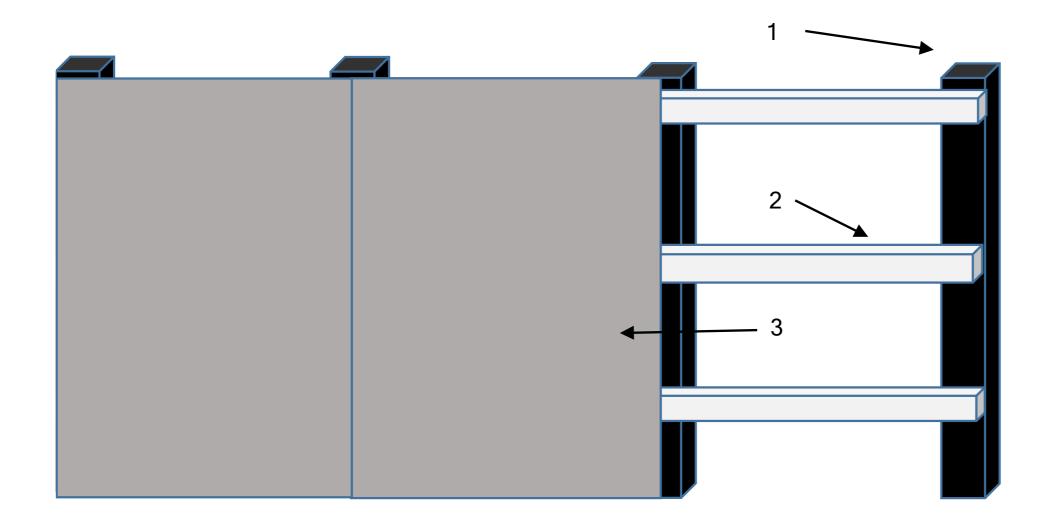

- 1. 100mm x 100mm timber posts at 1.2m centres
- 2. Three 100mm x 50mm timber rails
- 3. 12mm WBP Virola hardwood through plywood framed panels



Appendix 7 - Tree Protection Fencing Notice








# TREE PROTECTION AREA **KEEP OUT!**


(TOWN & COUNTRY PLANNING ACT 1990) TREES ENCLOSED BY THIS FENCE ARE PROTECTED BY PLANNING CONDITIONS AND/OR ARE THE SUBJECTS OF A TREE PRESERVATION ORDER. **CONTRAVENTION OF A TREE PRESERVATION ORDER MAY LEAD TO CRIMINAL PROSECUTION** 


ANY INCURSION INTO THE PROTECTED AREA MUST BE WITH THE WRITTEN PERMISSION OF THE LOCAL **PLANNING AUTHORITY** 

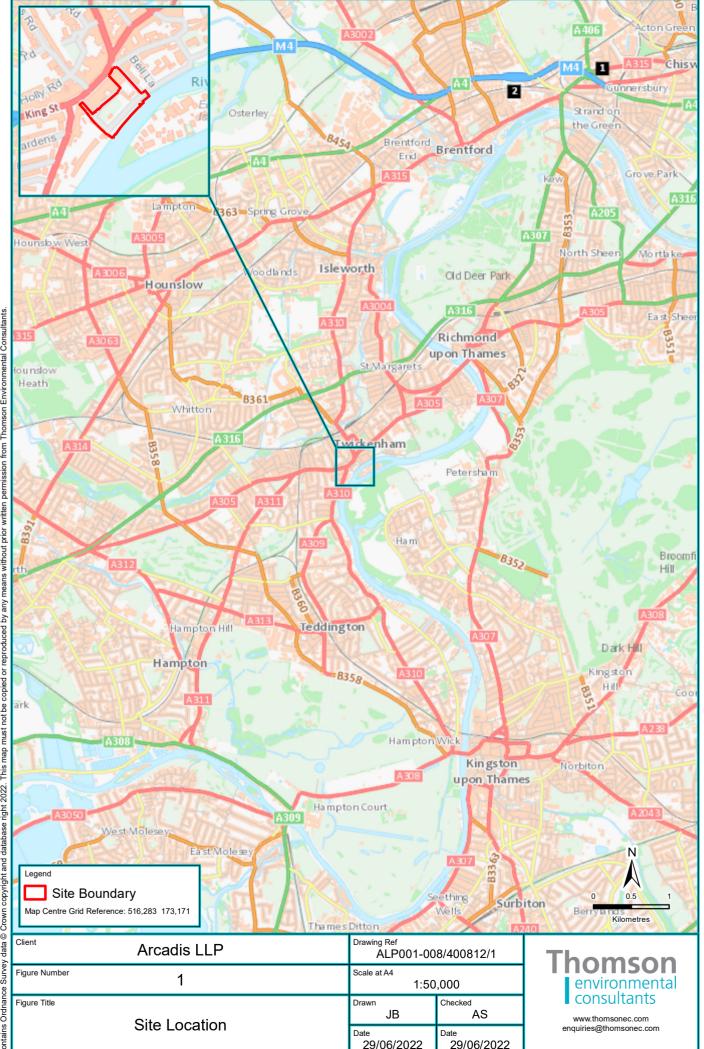


Fliepath: Y:Arboriculture/ALP001-008 - Arboricultural Services Twickenham Riverside/ALP001-008 1 - Twickenham Riverside Project ongoing arboriculturalsupport.2 DRAWINGS'.2.2 GISWorking\ALP001008 Fig1\_SiteLocation\_JB\_290622.mxd Contains Ordnance Survey data © Crown copyright and database right 2022. This map must not be copied or reproduced by any means without prior written permission from Thomson Environmental Consultants.



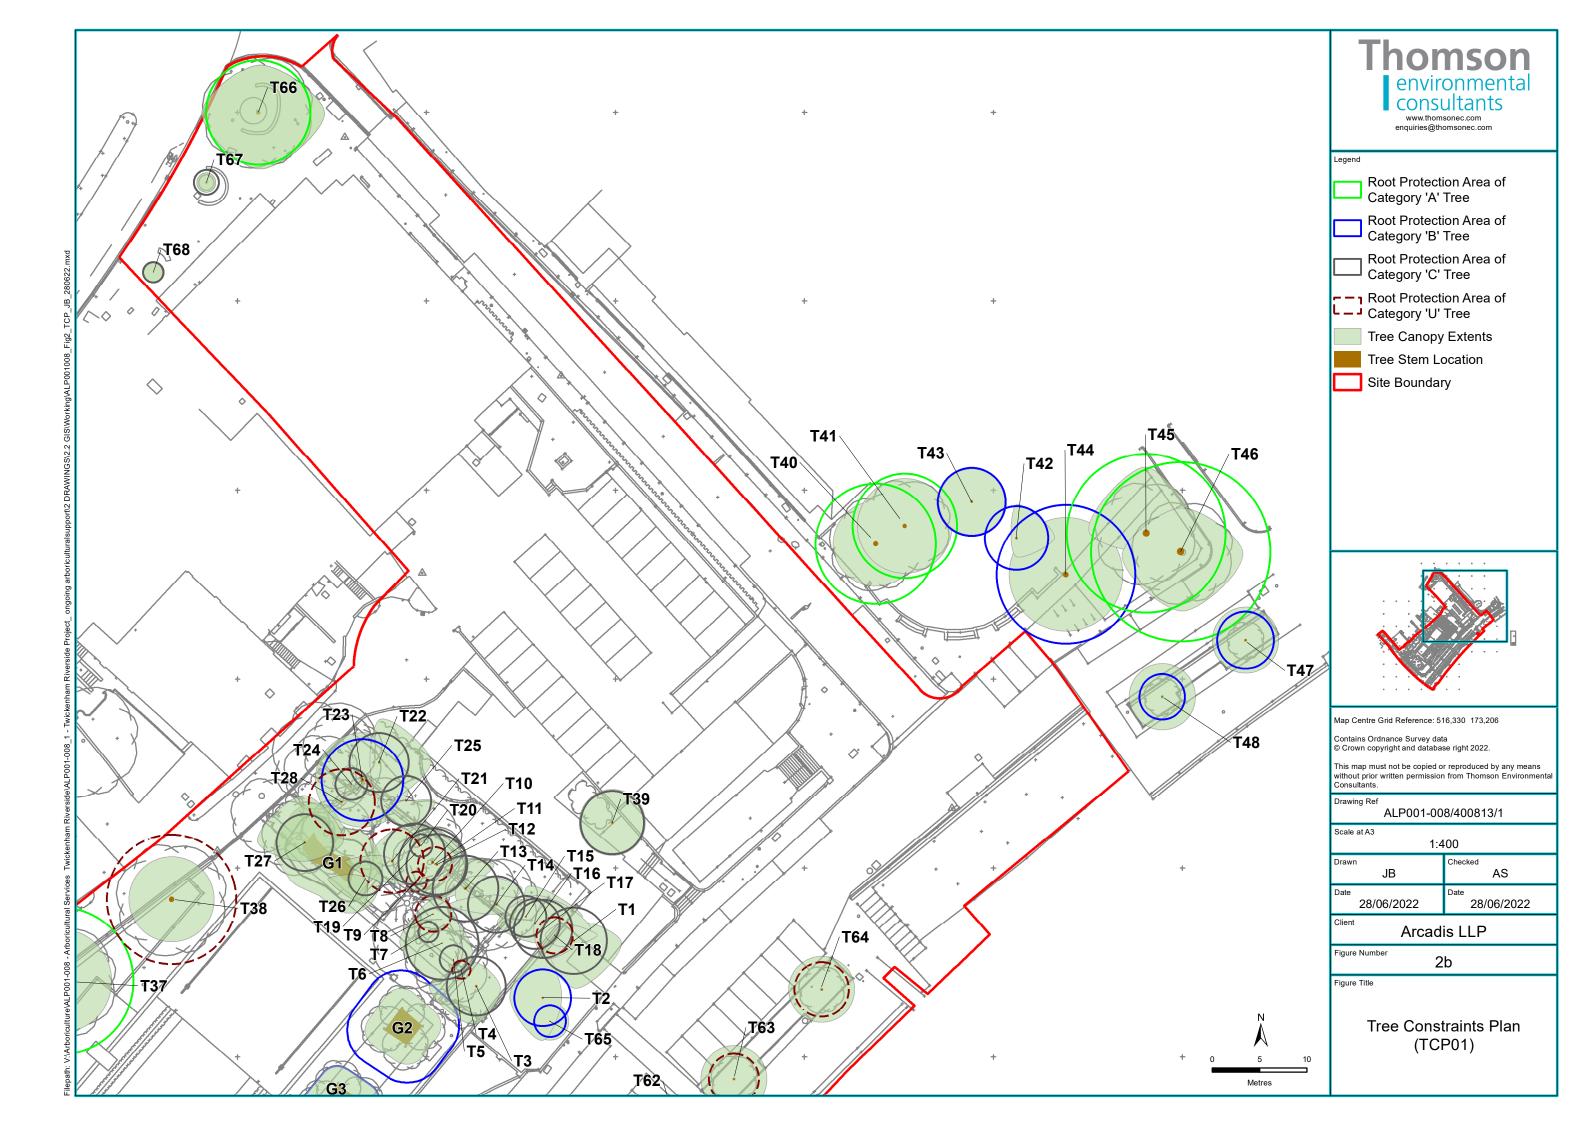

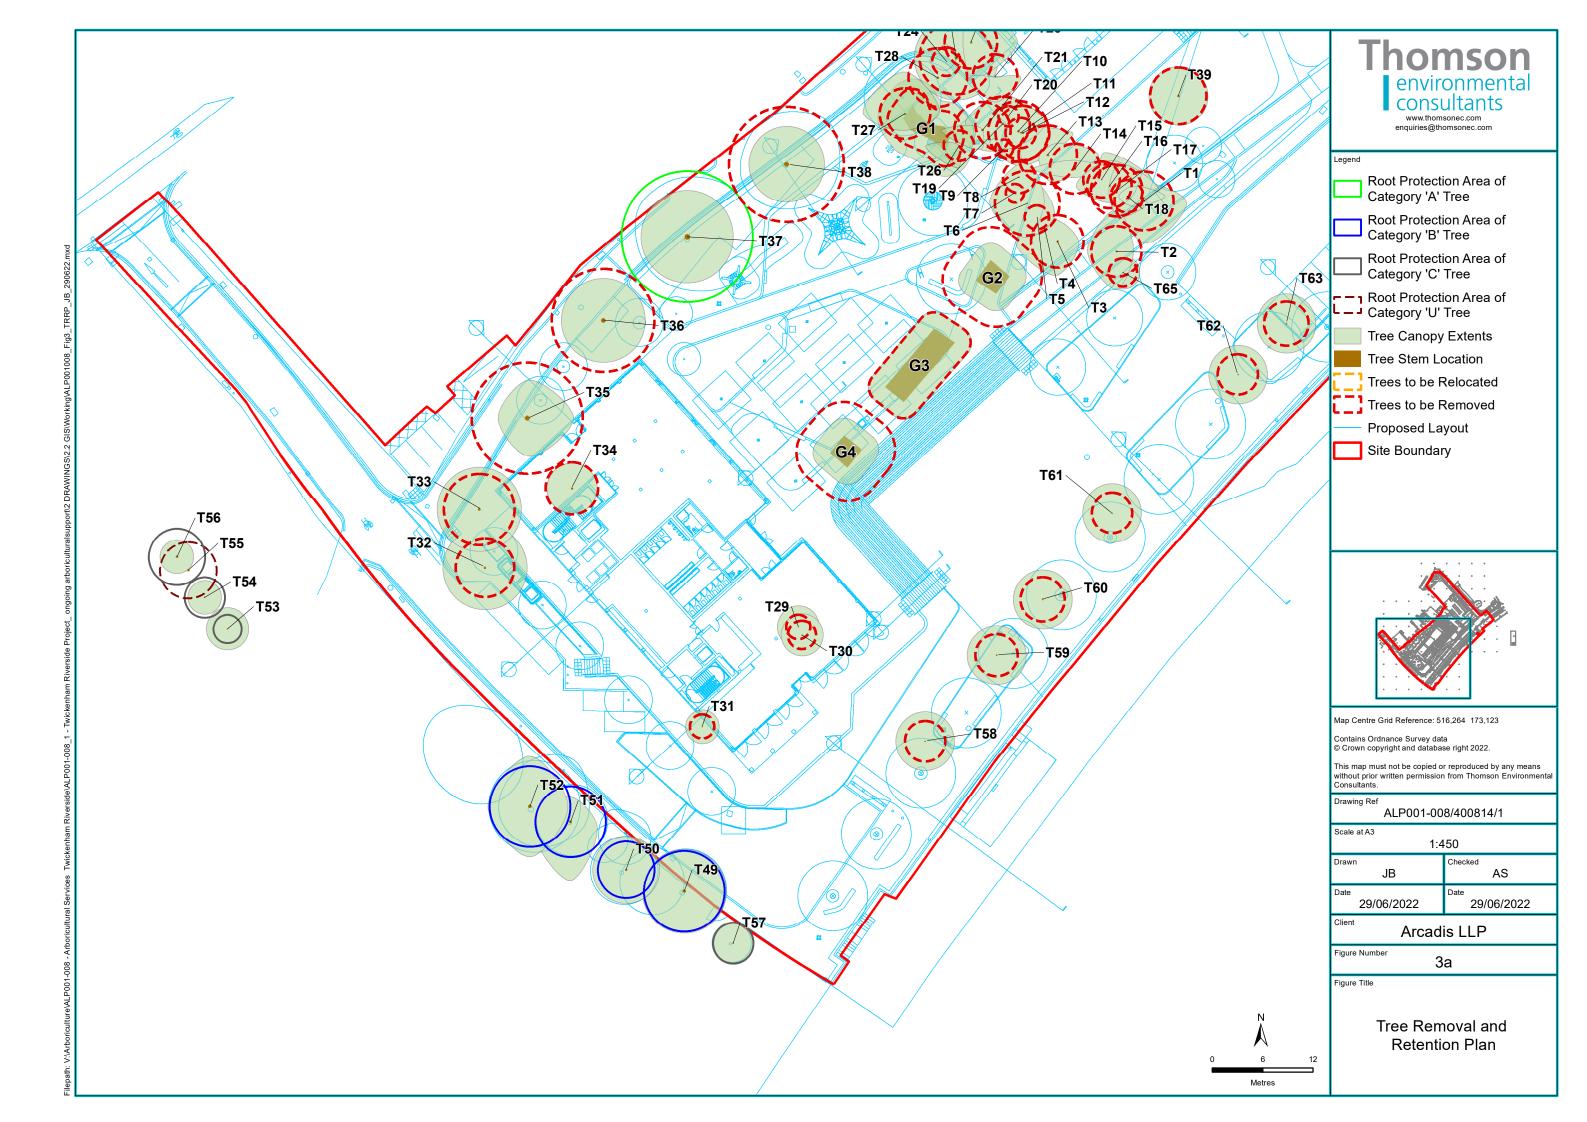

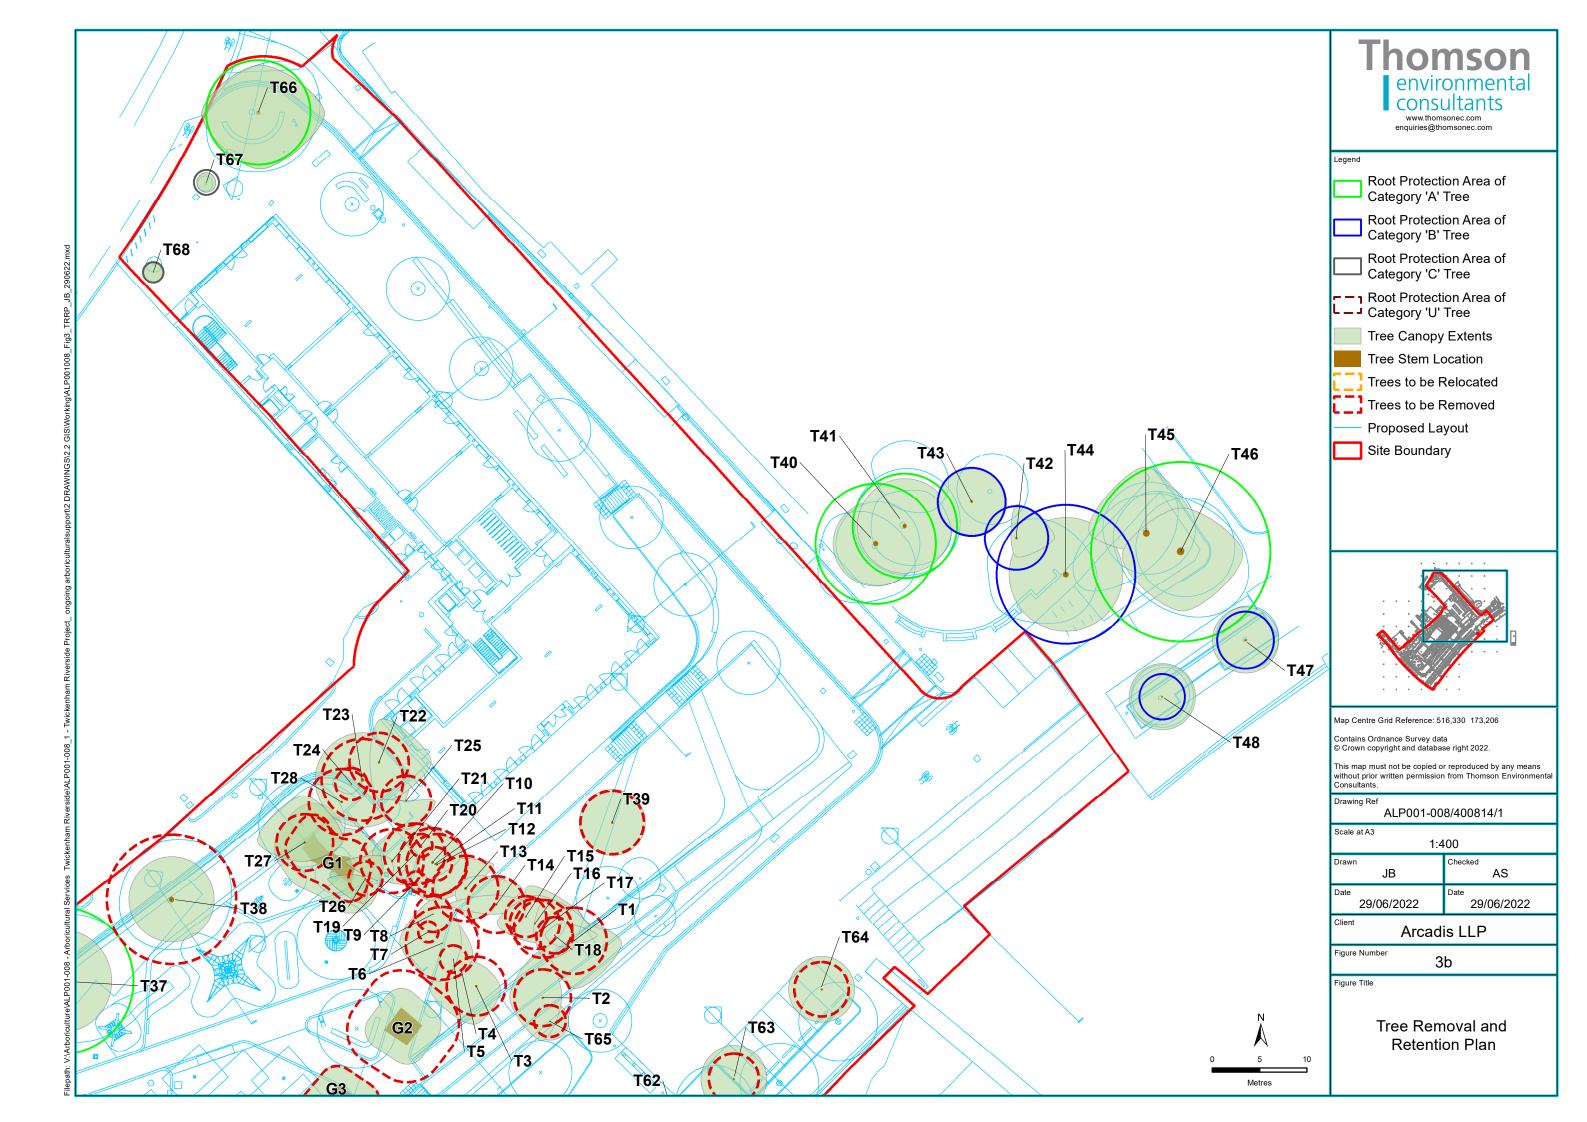

LP001008\_Fig4\_TPP\_JB\_290622.mxd