
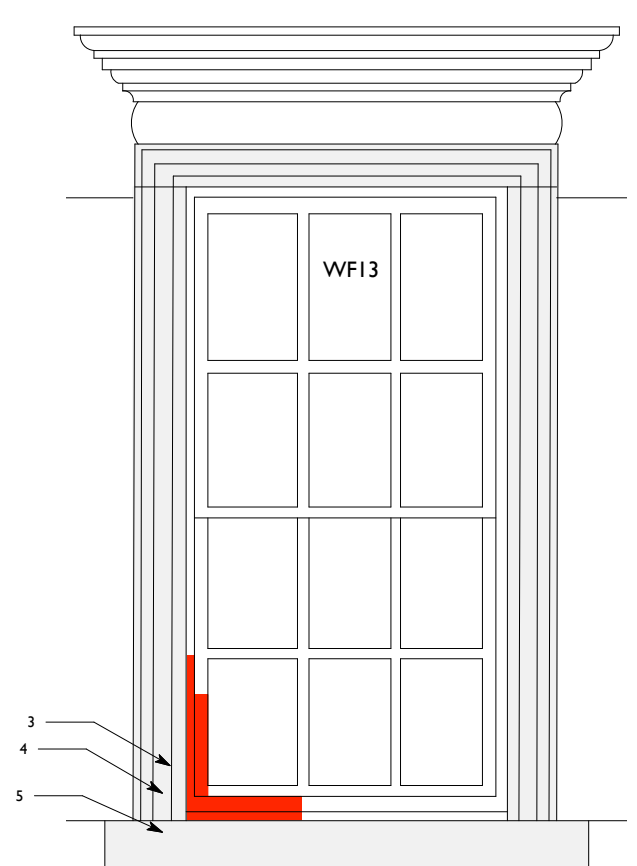
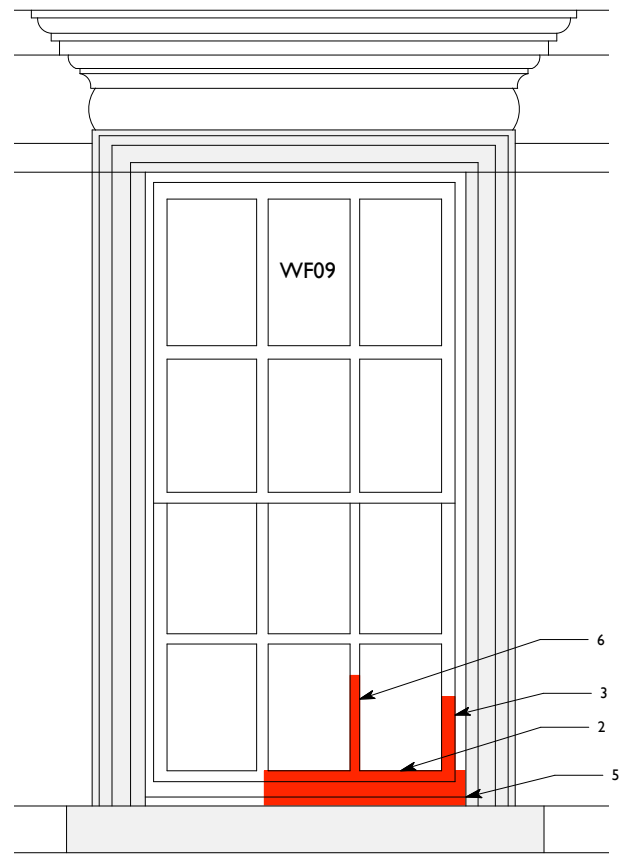


DO NOT SCALE THIS DRAWING USE DIMENSIONS ONLY
 VERIFY ALL DIMENSIONS ON SITE BEFORE COMMENCING ANY WORK OR SHOP DRAWINGS
 INFORM THE ARCHITECT BEFORE ANY WORK STARTS IF THIS DRAWING EXCEEDS THE QUANTITIES IN ANY WAY

Revision	Date
A	5 th September 2017

Amended for listed building consent

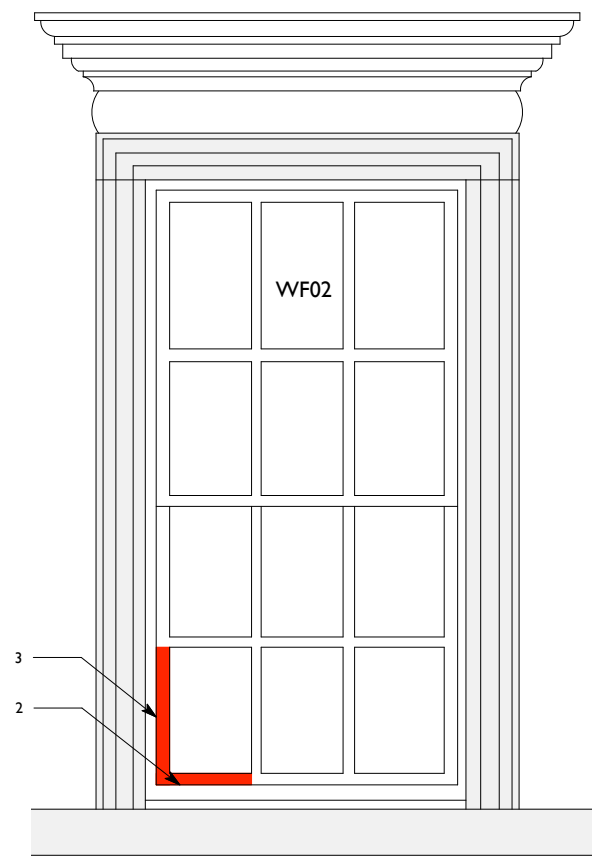





General Notes

- A. Refer to the Schedule of Works; which takes precedence over this drawing.
- B. Repairs to be carried out in accordance with Schedule of Works & Specification C51
- C. All new timber for use in repairs to be as per Specification C51; in principle this must be FSC® Certified Hardwood or Douglas Fir; and be fit for purpose for the high quality of repair and finish required.
- D. Once repairs are completed, all joinery repairs are to be repainted as per Specification C51 & M60; in principle this will be a modern primer and topcoat such as Dulux Weathershield. Colour 'BS 00 E 55 White' (BS 4800 Range).
- E. Glues to be used for repairs are detailed within the Specification C51; these will be modern waterproof glues joinery repairs and animal skin glues for all joints.
- F. All new sections of timber are to match the existing in size and profile; this will require bespoke profiles to be formed to match the existing profiles.

*Although other certification schemes exist, these are not acceptable. Proof of certification will be required.

Notes

- 1. Replace bottom rail.
- 2. Piece in repair to bottom rail.
- 3. Piece in repair to stile.
- 4. Piece in repair to outside lining board.
- 5. Piece in repair to sill.
- 6. Replace glazing bar.
- 7. Replace door panels.

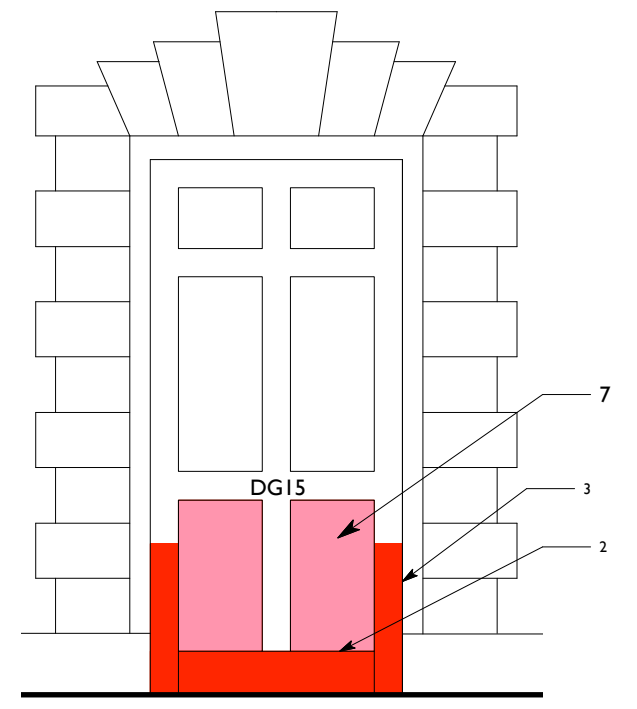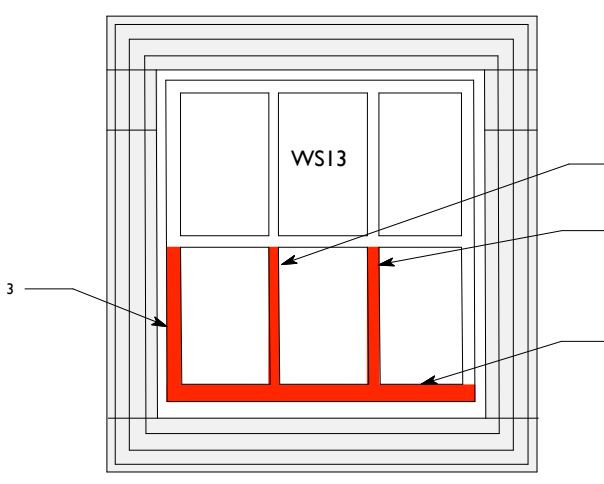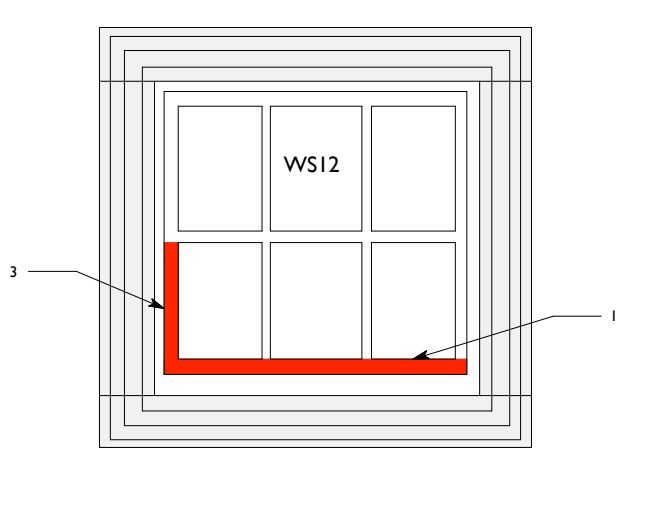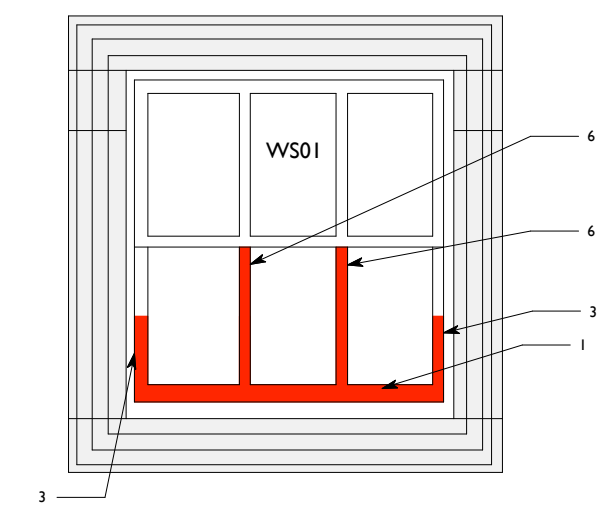

DRAWING ISSUE STATUS	REVISION N°	DATE	SIGNED
RISK ASSESSMENT UNDERTAKEN			
PLANNING APPLICATION N° 1			
PLANNING APPLICATION N° 2			
PLANNING CONSENT			
LISTED BLDG APPLICATION			
LISTED BLDG CONSENT			
DAC APPROVAL			
BLDG CONTROL APPLICATION			
BLDG CONTROL APPROVAL			
TENDER DOCUMENT			
CONTRACT DOCUMENT			

CLIENT
English Heritage

PROJECT
Marble Hill House



TITLE
Window Repair Schedule;
including Door DG15

SCALE
1:25 @ A3

DATE
August 2017

JOB N°
16_132

DRAWN
HS

DRAWING N°
315A

Acanthus House
57 Hightown Road
Banbury • Oxfordshire
OX16 9BE
Tel: 01295 702600
Fax: 01295 702601
architects@acanthusclews.co.uk
www.acanthusclews.co.uk

