

**Builders Works In Connection with M&E Improvements**

1. Allow to lift 50 % of the timber floor boards. The boards are of the following description:

- a) The in room G03 and across the first floor, the floors are boarded with fine mahogany boards firmly nailed down with concealed nail heads and connecting timber dowels. Care and attention will be taken to avoid damage; lifting will be by a careful and skilled conservation joiner.
- b) The second floor has a slightly lower quality of floorboarding this is a paler hardwood and the boards are fixed with concealed nail heads. These boards should not be damaged and need to be lifted by a careful and skilled conservation joiner.
- c) The Garret (Third Floor) is floorboarded with pine boards fixed down with pozi drive fixings. These boards should be easy to remove and replace with no damage.

It is proposed for new wiring to follow the existing routes; allow for additional notching joists to facilitate the installation of wiring (refer to structural engineer's drawing 17549-SK-N1 for details); where possible the existing routes will be used. Allow to carefully reinstall the boarding in the same manner as they were found. This will include the filling/waxing of nail head entry points with joiners wax, to match in with the existing wood. Allow as a provisional item, to replace 5% of the boards lifted, in a like for like quality, size and finish as the existing.

3. All Floors: Allow to open up existing vertical service duct; discard all covers, boxing & etc... Install the following:

- 1) Sub-main cabling from main MCCC panel to final circuit DB's on Attic floor; run in 100 x 50 mm trunking.
- 2) From Attic lighting and power circuits will run to the Second Floor; run in 100 x 50 mm trunking.
- 3) From Basement, lighting and power circuits will be fed to the Ground & First Floors; run in 100 x 50 mm trunking.

Once installed, plaster over trunking with new lime putty hair plaster; where necessary wooden or stainless steel lathe may be required; paint plaster to match.

5. Allow to open up existing chase; assume the following works:

TD = Top Down; form chase upwards from fitting, ensuring that no damage is caused to the cornice. Make good chase with haired lime putty plaster. Painting to match in.


BU= Bottom Up; form chase downwards from fitting, removing the skirting boards as appropriate. Make good chase with

haired lime putty plaster. Painting to match in. Refit the skirting board.

- 8. Intruder Detection System Cable; parts of this may need to be replaced. If this needs to be done, new cable will be fixed as existing to the top of the skirtings and follow the existing routes. Where the cable crosses doors or windows, replacement will follow the existing route re-using or using equivalent fixings.
- 9. Indicated floorboards may need to be lifted to allow the repair of the intruder detection system wiring. Read with note 1.
- 10. It is possible that repairs to the intruder detection system hardware & wiring to the external windows & doors may need to be carried out. Possible works include the replacement of the existing security detectors to the window or door by a skilled conservation carpenter; these are screwed in place; also it is possible that limited 'fishing' of replacement wiring along the existing routes within the window or door lining may be necessary.

DO NOT SCALE THIS DRAWING USE DIMENSIONS ONLY  
 VERIFY ALL DIMENSIONS ON SITE BEFORE COMMENCING ANY WORK OR SHOP DRAWINGS  
 INFORM THE ARCHITECT BEFORE ANY WORK STARTS IF THIS DRAWING EXCEEDS THE QUANTITIES IN ANY WAY

Revision	Date	
A	4th April 2017	
B	1st September 2017	Amendment following co-ordination with M&E Engineer Notes amended for planning submission

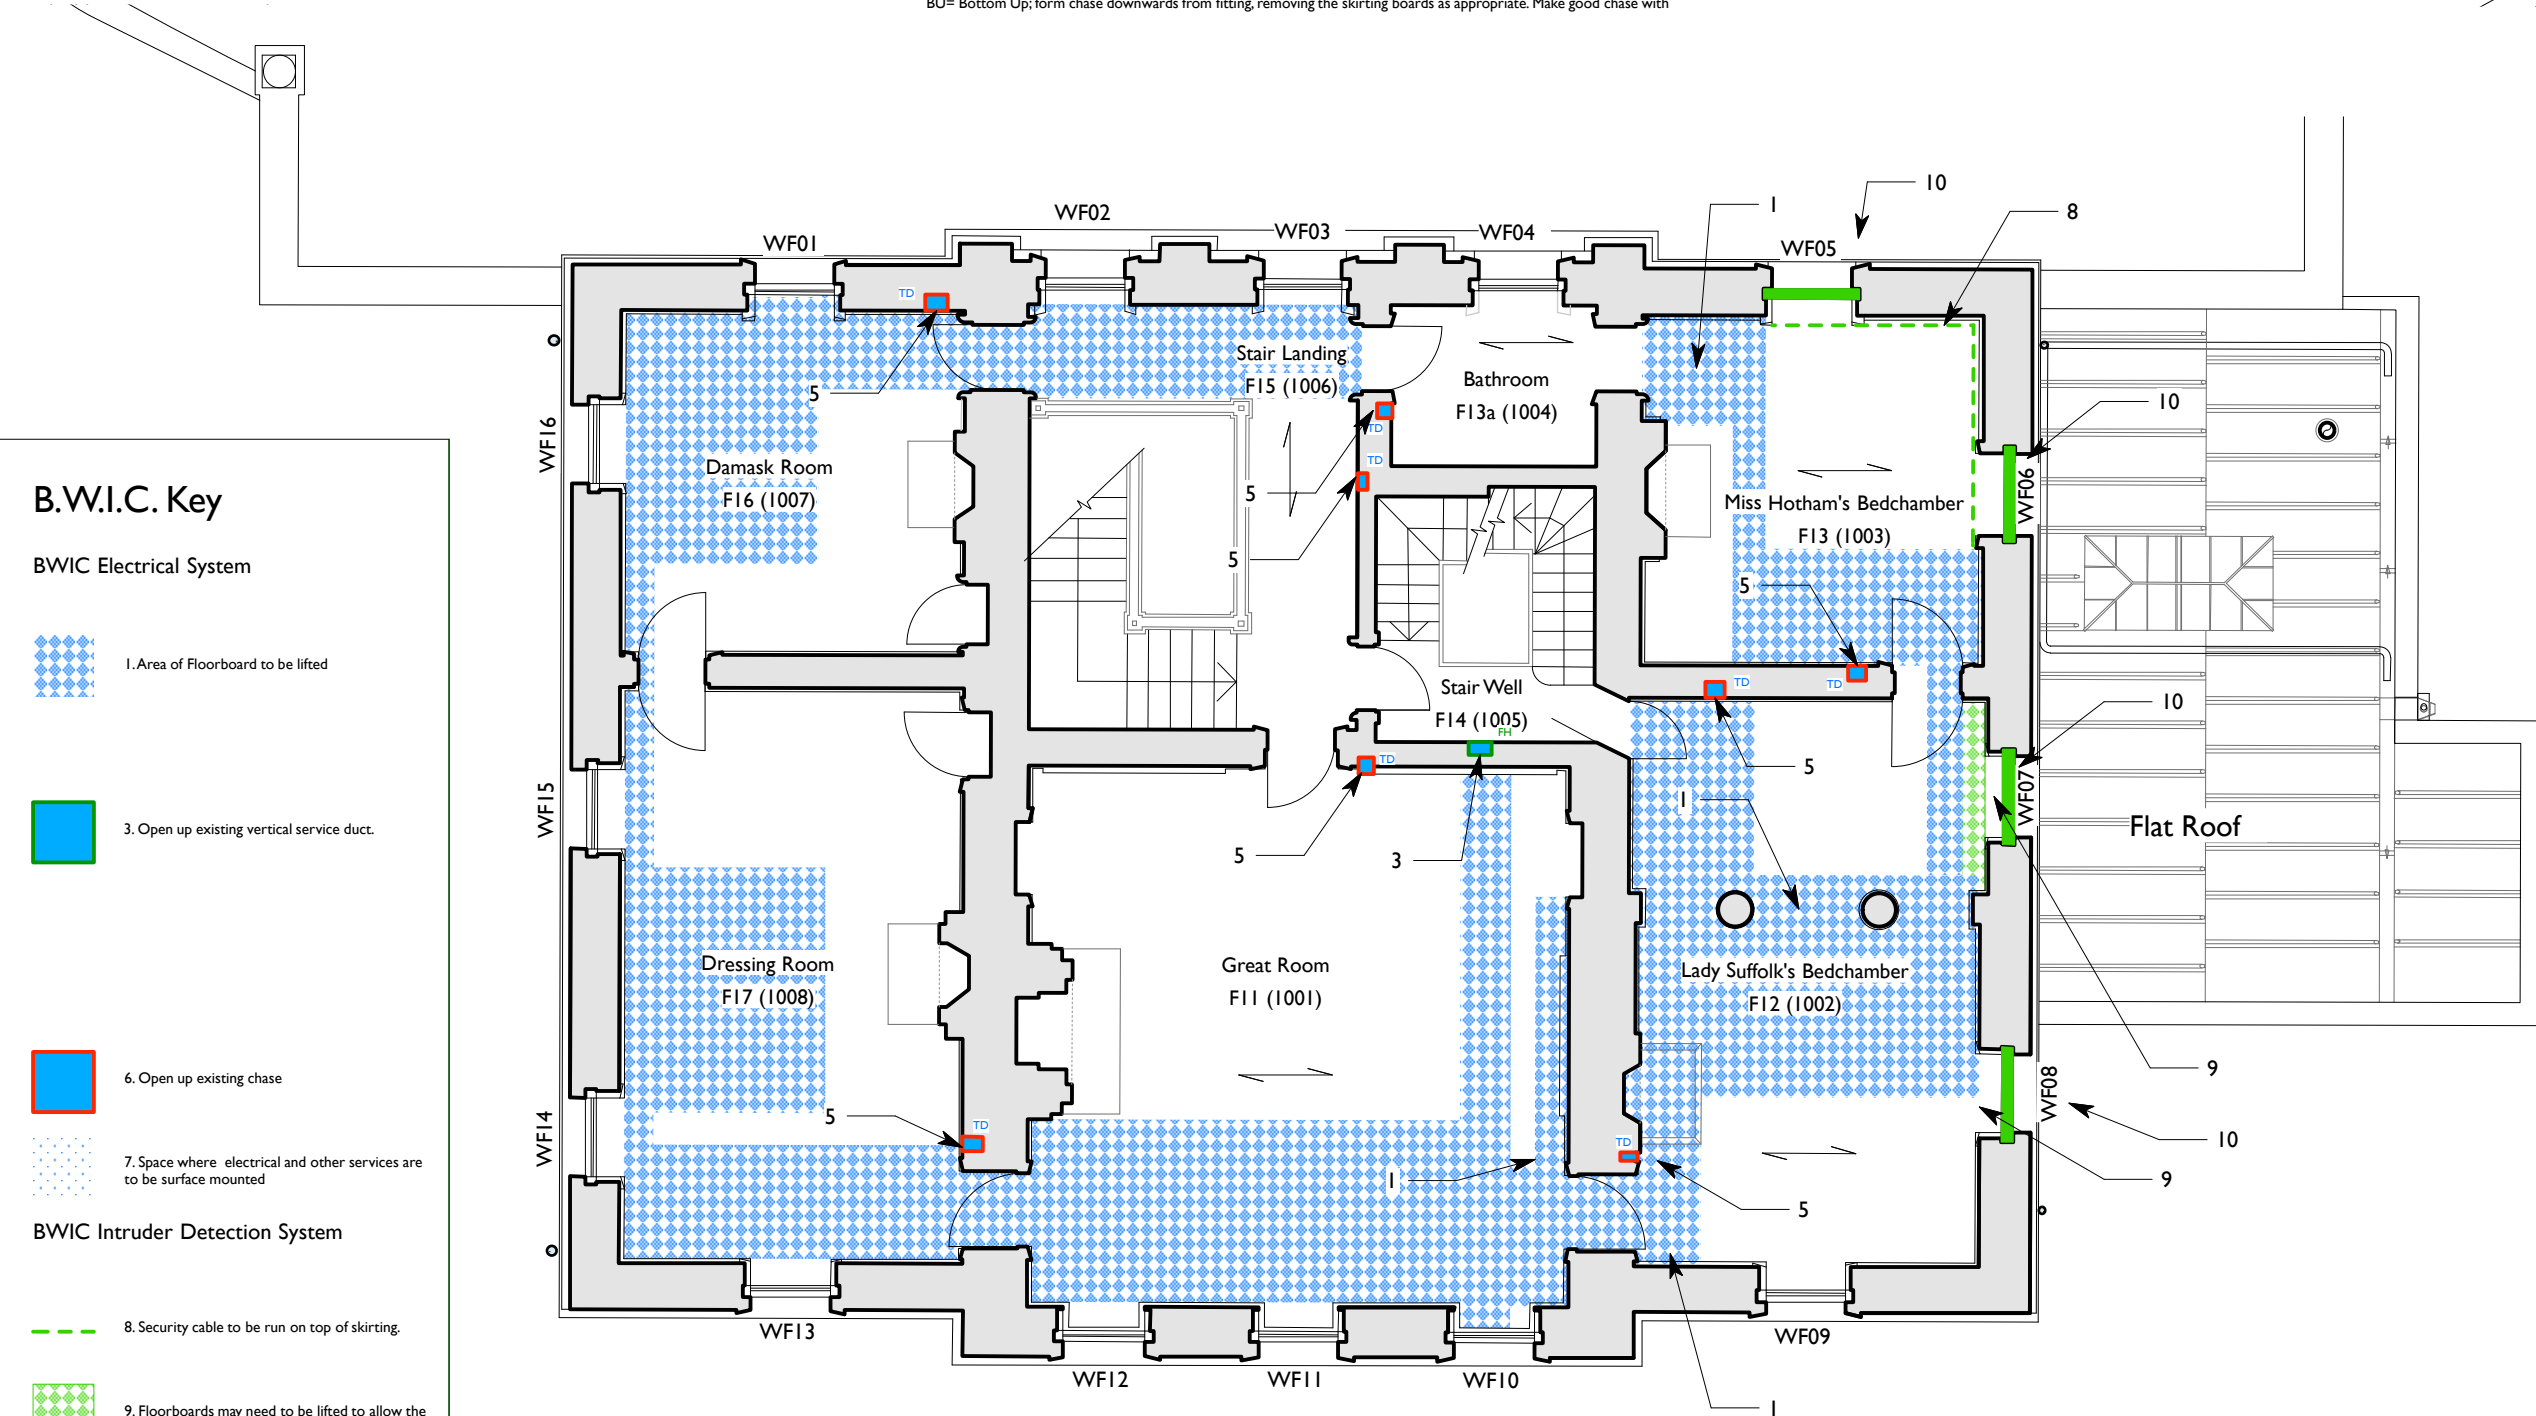

**B.W.I.C. Key**

**BWIC Electrical System**

- 1. Area of Floorboard to be lifted
- 3. Open up existing vertical service duct.
- 6. Open up existing chase
- 7. Space where electrical and other services are to be surface mounted

**BWIC Intruder Detection System**

- 8. Security cable to be run on top of skirting.
- 9. Floorboards may need to be lifted to allow the replacement of failed security wiring.
- 10. Security fittings to door or window to be possibly replaced; this is pending report from security installation specialist.



**First Floor Plan**

DRAWING ISSUE STATUS	REVISION N°	DATE	SIGNED
RISK ASSESSMENT UNDERTAKEN			
PLANNING APPLICATION N° 1			
PLANNING APPLICATION N° 2			
PLANNING CONSENT			
LISTED BLDG APPLICATION			
LISTED BLDG CONSENT			
DAC APPROVAL			
BLDG CONTROL APPLICATION			
BLDG CONTROL APPROVAL			
TENDER DOCUMENT			
CONTRACT DOCUMENT			

CLIENT  
English Heritage

PROJECT  
Marble Hill House

TITLE  
Main House:  
First Floor Plan;  
Builders Work In Connection With  
M&E

SCALE  
1:100 @ A3

DATE  
April 2017

JOB N°  
16\_132

DRAWN  
HS

DRAWING N°  
261 B

Acanthus House  
57 Hightown Road  
Banbury • Oxfordshire  
OX16 9BE  
Tel: 01295 702600  
Fax: 01295 702601  
architects@acanthusclews.co.uk  
www.acanthusclews.co.uk